



Service Bulletin

File in Section: -

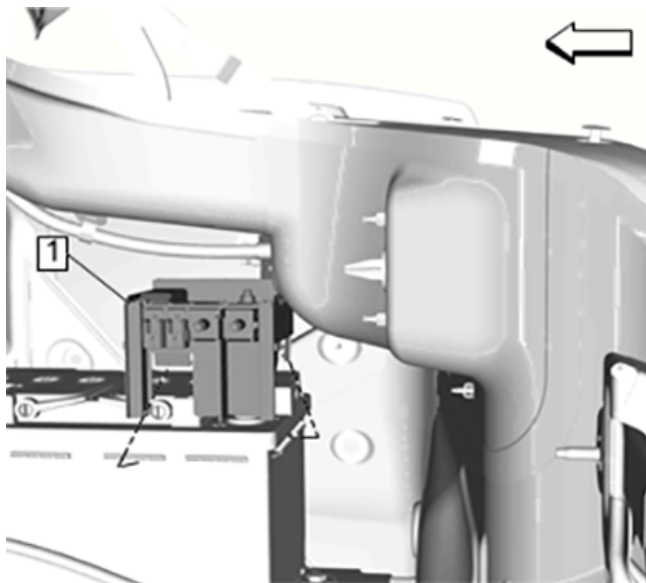
Bulletin No.: 18-NA-375

Date: December, 2018

INFORMATION

Subject: Information on Diagnosis of No Start, Radio Click Noise or Inoperative, Malfunction Indicator Lamp (MIL) Illuminated, and/or Various Electrical Issues

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Camaro	2016	2019			All	All

Involved Region or Country	North America and N.A. Export Regions
Condition	Some customers may comment on any number of the following conditions: • No start. • Radio making a clicking noise, or inoperative. • MIL illuminated. • Various other electrical issues.
Cause	The cause of the condition may be water intrusion into the electrical components located in the rear compartment area.  5187163 Some technicians may find water intrusion related damage at the Rear Body Fuse Block (1).
Correction	To determine the source of water intrusion, water test and inspect the following areas: • Rear compartment lid weatherstrip area. • Rear body structure stop lamp pockets. • Rear body structure stop lamp foam missing. • Seams around rear window. • Sunroof drain hose disconnected or damaged. • Missing or not fully seated body plugs (2 plugs located below the rear window on convertibles).

Note: If no water leaks are detected in any of the areas listed above, the water leak could be caused by the deck lid not being fully closed, ice melting or liquids being spilled inside the trunk area.

If the source of the water leak is determined to be caused by a manufacturing defect, replace modules and repair wiring as necessary and please submit a field product report with details and photos of concern.

Warranty Information

Submit the appropriate labor operation(s) from the Labor Time Guide, for any necessary manufacturing defect repairs.

Version	1
Modified	Released December 14, 2018

