

MBUX multimedia system: Time and timezone cannot be selected

Topic number	LI82.85-P-069070
Version	1
Function group	82.85 Navigation and Communication system (CNS, ICS, COMAND, FleetBoard)
Date	11-19-2018
Validity	BR177 with MBUX code 548/549 without code 365
Reason for change	Damage code added
Reason for block	

Complaint:

In the MBUX multimedia system (A26/17) it is not possible to set the time and the timezone in the subgroup in the Vehicle menu.

Cause:

The coding of the MBUX multimedia system (A26/17) for timezone recognition is not correct.

Remedy:

Perform an initial startup of the MBUX multimedia system (A26/17) with the latest add-ons.

After initial startup, the MBUX (A26/17) software E219, 18/34.10 or newer should be installed.

Note: Please do not replace any parts.

Symptoms
Communication/information / Information display / Displays / Clock / Malfunction
Communication/information / Information display / Displays / Clock / Too fast
Communication/information / Information display / Displays / Clock / Too slow

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			53623 E9	Head unit time setting function