

Wind noises/whistling noises at speeds above approx. 140 km/h

Topic number	LI88.85-P-059178
Version	3
Function group	88.85 Trim strips
Date	11-15-2018
Validity	MODEL 463 (up to prod. 04/2018)
Reason for change	Part number of adhesive has been changed
Reason for block	

Complaint:

Wind noises/whistling noises from front area of roof or from area of instrument panel/windshield at speeds above approx. 85 mph

Cause:

The airstream can cause the rubber strip of the windshield to whistle.

Note: To verify cause, tape down the strip.

Remedy:

Seal the lower lip of the rubber strip at the top of the windshield in the installed state across the entire width with window adhesive.

Attachments	
File	Description
Sealing.jpg	Sealing with 2-component adhesive

Symptoms
Body / Body/Cab / Body noises / Wind noises

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 005 989 61 71			Window cement	1		X