

## Document Information

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.

Vehicles affected: P12: P1

Location: Powertrain Systems – Cooling System

Concern: Hybrid System Fault warning message on the instrument cluster


Condition: Permanent

## Diagnostic Trouble Codes

N/A

## Measure

The warning message “Hybrid System Fault” (screenshot below) is **not** related to the vehicle’s Hybrid System when is **not** followed by “12V Battery Discharging” and Engine MIL light.

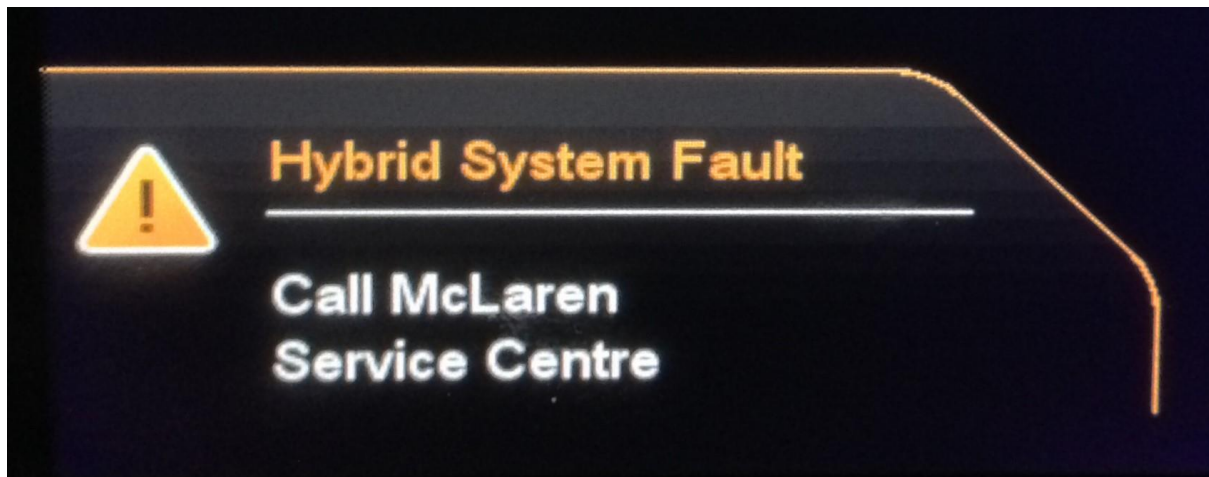

This warning message relates to the coolant system of the vehicle and does not generate a DTC.

- Check the engine coolant level.
- With the use of the coolant displacement tool kit, check the coolant displacement. Refer to SIS instructions BA-RM-04L001-00-001 - Drain/fill fluid - cooling system - Step 23.

If the displacement is outside the limit, proceed with the full vacuum bleed of the coolant system as per the SIS instructions.

- Once the coolant displacement is within the limits, test drive the vehicle to confirm the warning message is not returned.

## MTI Updates Information

N/A

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.