

Document Information

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.

Vehicles affected: P13R: 600LT

Location: Electrical - Electrical Systems

Concern: Unable to operate the main luggage compartment via the auxiliary switchpack on driver's door

Condition: Permanent

Diagnostic Trouble Codes

SBC:

B130155 Unit Not Configured/Car Config Not consistent

B130813 Engine Bay Release Latch 1 Drive:Open Circuit or Short to Battery

Measure

A number of McLaren 600LT vehicles have left production with a risk of not been able to open the main luggage compartment with the button available on the driver's door auxiliary switchpack.

There are two DTCs logged in the SBC that can be ignored at this stage.

The luggage compartment is still operative when opened via the key fob and/or centre console switch.

A new SBC software is now available to resolve this issue, please ensure the SBC is updated to the latest software.

Once SBC is reprogrammed, check the operation of the glove box. If glove box is inoperative, please raise a Technical Request. A remote support session will be arranged as Technical Support team will need to run a Sequence within SBC that is password protected.

MTI Updates Information

N/A

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.