

DTNA Solutions > Service Solutions > Freightliner > SS-1033353 FCCC S2G Cab Lean

SS-1033353 FCCC S2G Cab Lean


Title - SS-1033353 FCCC S2G Cab Lean

Applicable Vehicles - Certain 2013 thru 2015 FCCC S2G cab/chassis vehicles.

Symptoms - May have a cab lean or cab squeak around the track bar area

Issue - Certain Freightliner Custom Chassis Corporation's S2G models may have a cab lean or squeak. Use this solution to help determine if the issue is caused by the cab track bar hardware.

Solution - If a vehicle is exhibiting either an unexplained cab lean or cab squeak in the track bar mounting bushings, verify the pivot bolts size. The correct hardware should be 5/8" (5/8" bolt has a 15/16" hex head - 1/2" bolt will have a 3/4" hex head bolt), If found to have 1/2" hardware replace it with 5/8" : 23-11755-350 - bolt, 23-09114-000 - washer, 23-13179-110 - lock nut. Torque this hardware to 40 - 50 ftlbs. Either end of the track bar could be effected.

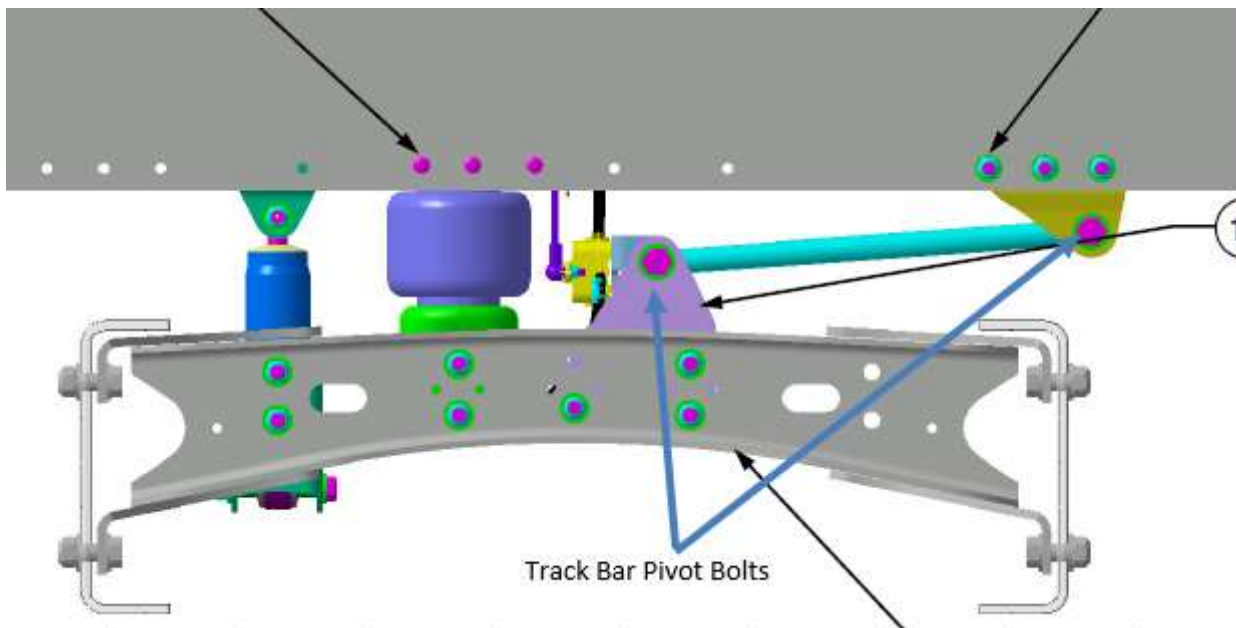

Labels :

Cab | Body Windshield | WiperWash | and Doors

FCCC

cab lean

cab squeak fccc s2g s2g

Add tags



0 Kudos

