

Window lifter reverses direction

Topic number	LI72.40-P-065822
Version	4
Function group	72.40 Door control
Date	04-09-2018
Validity	MODEL 213
Reason for change	Remedy revised
Reason for block	

Complaint:

Window lifter reverses direction on reaching upper end position.

Cause:

Possibly due to software adjustment in door control unit (N69/X).

Remedy:

Ensure the door control unit is updated to the latest software release and then perform SCN coding for the vehicle.

(Path: Xentry Diagnostics => Control units view => DCU-XX (N69/X) => Adaptations => Commission)

Note: The new SCN coding is only available for the current software release!

Symptoms
Body / Glazing / Window lifting mechanism/window operation / Remains stationary
Body / Glazing / Window lifting mechanism/window operation / Does not run up
Body / Glazing / Window lifting mechanism/window operation / Stiff/sluggish
Body / Glazing / Window lifting mechanism/window operation / Opens by itself

Control unit/fault code		
Control unit	Fault code	Fault text
N69/1 - Left front door (DCU-LF) (DMFL213)	-	-
N69/2 - Right front door (DCU-RF) (DMFR213)	-	-
N69/3 - Left rear door (DCU-LR) (DMRL213)	-	-
N69/4 - Right rear door (DCU-RR) (DMRR213)	-	-

XENTRY TIPS

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			72220 GR	
			72230 GR	
			73A30 GR	
			73N30 GR	