



Technical Journal

TITLE:

Steering wheel off center

REF NO: TJ 33715.1.0	ISSUING DEPARTMENT: Technical Service	CAR MARKET: United States and Canada	
PARTNER: 3 US 7510 Volvo Car USA		ISSUE DATE: 2018-04-18	STATUS DATE: 2018-04-26
FUNC GROUP: 6410	FUNC DESC: Steering wheel, column lock, steering co	Page 1 of 3	

“Right first time in Time”

Attachment

File Name	File Size
TJ 33715.jpg	0.1113 MB

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
536							2019-9999		0000001-9999999	201746-999952

CSC Customer Symptom Codes

Code	Description
QE	Steering wheel/Steering wheel spokes not correctly positioned

VST Operation Number

VST Operation Number	Description
96387-2	Troubleshooting steering: QE

DTC Diagnostic Trouble Codes

Text



DESCRIPTION:

If steering wheel is off center while driving straight forward, then follow Service below.

The steering wheel is always positioned correctly at the assembly line, but if the steering wheel is removed for various adjustments it may not be reinstalled correctly on the steering column.

SERVICE:

1. Remove driver's airbag according to VIDA (VCC-ID: VCC-502656-1)
2. Remove the screw for the steering wheel according to VIDA (VCC-ID: VCC-502279-1)
3. Align the steering wheel to the steering column, follow the markings according to the picture TJ 33715.jpg
4. Reinstall all parts according to VIDA (torque screw 60 N)
5. Perform a wheel alignment on front wheels according to VIDA (VCC-ID: VCC-502859-1)
5. Verify repair

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect, or if the structure week is 201814 or later.

Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 6410.

To view TJ attachment continue to next page. This TJ has one attachment.

