

Technical Journal

TITLE:

Mirror cover, noise

| REF NO: TJ 33170.2.0 | ISSUING DEPARTMENT: Technical Service | | ARKET: s and Canada |
|-------------------------|--|---------------------------|----------------------------|
| 3 US 7 | PARTNER: 7510 Volvo Car USA | ISSUE DATE: 2018-02-01 | STATUS DATE: 2018-02-05 |
| FUNC GROUP: 8554 | FUNC DESC: Upholstery for roof with retainer | Page | 1 of 6 |

"Right first time in Time"

Attachment

| File Name | File Size |
|--------------|-----------|
| TJ 33170.pdf | 0.4934 MB |

Vehicle Type

| Type | MILLO | Eng Desc | Sales | Body | Gear | Steer | Model Year | Plant | Chassis range | Struc Week Range |
|------|-------|-------------|-------|------|------|-------|------------|-------|-----------------|---------------------|
| 234 | | | | | | | 2017-9999 | | 0000350-0999999 | 201617-999952 |
| 235 | | | | | | | 2018-9999 | | 0000160-0999999 | 201624-999952 |
| 236 | | | | | | | 2018-9999 | | 0000098-0999999 | 201646-999952 |
| 238 | | | | | | | 2018-9999 | | 0000161-0999999 | 201646-999952 |
| 246 | | | | | | | 2018-9999 | | 0000390-0999999 | 201717-999952 |

CSC Customer Symptom Codes

| Code | Description | |
|------|--------------------------------|--|
| G4 | Headlining/Unusual noise | |
| 2N | Overhead console/Squeak/rattle | |

VST Operation Number

| VST Operation Number | Description |
|----------------------|---|
| 98696-2 | Rear view mirror cover interior replace acc. to TJ33170 |

Technical Journal 33170.2.0



DTC Diagnostic Trouble Codes

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

Text

DESCRIPTION:

If customer complains of a squeaking noise from the inner mirror area when driving uneven or bumpy roads, follow the repair method under Service.

SERVICE:

* Install two foam pieces (p/n 30649094) in mirror cover according to method in "TJ33170.pdf"

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 8554.

To view TJ attachment continue to next page. This TJ has one attachment.

Page 2 of 6 2018-02-05



Volvo Car Customer Service

TJ 33170

| Title | Inner rear view mirror | Page | 1 (4) |
|--------|------------------------|-------------------|---------|
| Action | Product fix | Operation number: | 98696-2 |

| Issue | Date | Reason |
|-------|---------|-------------|
| 1 | 2017-11 | First issue |

Affected vehicles

| Model year | Model |
|------------|-------------------|
| 2017 | S90 (17-) |
| 2018 | S90L |
| 2018 | V90 (17-) |
| 2018 | V90 Cross Country |
| 2018 | XC60 (18-) |

Materials


| Materials | Qty. | Part No. | Notes |
|-----------|------|----------|-------|
| Tape | 1.0 | 30649094 | |

TJ 33170 Page 2 (4)

Removal


Note! Removal steps in this procedure may contain installation details.

Color symbols

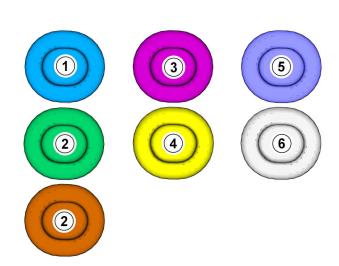


Note! This colour chart displays (in colour print and electronic version) the importance of the different colours used in the images of the method steps.


- Used for focused component, the component with which you will do something.
- 2 . Used as extra colors when you need to show or differentiate additional parts.
- 3 . Used for attachments that are to be removed/installed. May be screws, clips, connectors, etc.
- 4 . Used when the component is not fully removed from the vehicle but only hung to the side.
- 5. Used for standard tools and special tools.
- Used as background color for vehicle components.

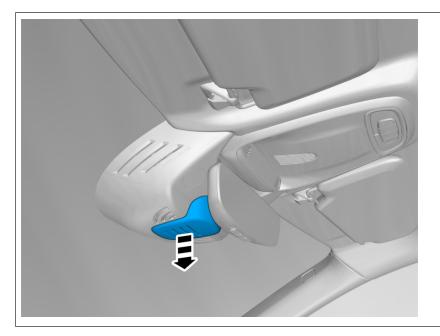


Remove the marked part.

TJ 33170 Page 3 (4)

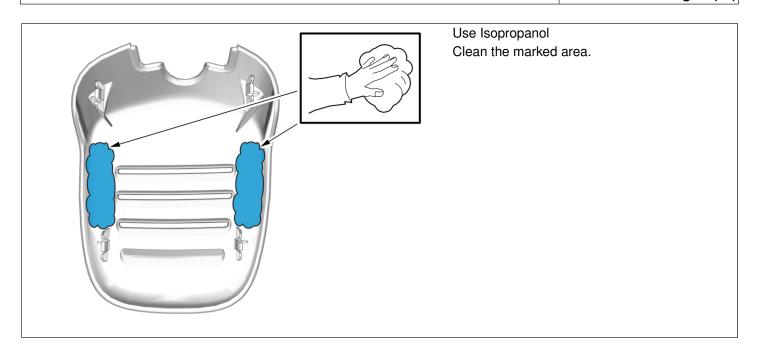

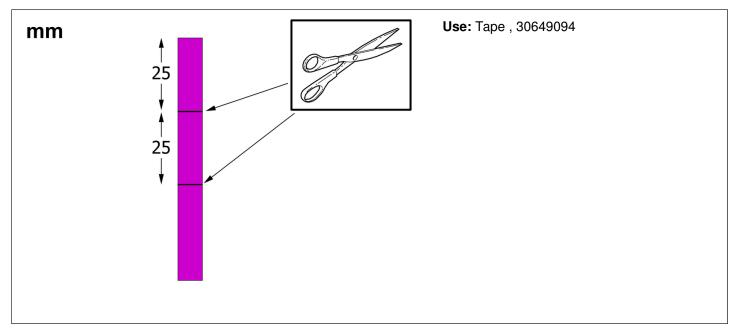

TJ 33170 Page 4 (4)

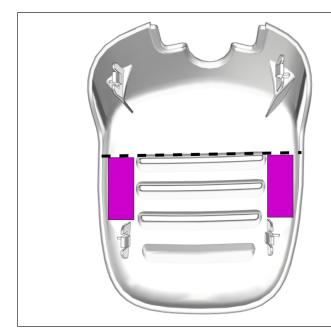

Note! Ensure that the tape is fixed to the surface.

Install the marked components.

Installation

To install, reverse the removal procedure.