HONDA

January 12, 2019

Version 4

Product Update: 2016-18 Civic: Software Update with A/C Control Unit Replacement; DTC P0300, P0301, P0302, P0303, P0304, or P0172

Supersedes 18-137, dated January 8, 2019, to revise the information highlighted in yellow

REVISION SUMMARY

• Under WARRANTY CLAIM INFORMATION, the flat rate time was updated

AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2016	Civic	EX, EX-L, Touring (2-Door, 4- Door)	Check the iN VIN status for eligibility.
2017	Civic	EX, Touring, Si (2-Door, 4- Door)	Check the iN VIN status for eligibility.
2017	Civic	LX, LX With Honda Sensing, EX, Sport, EX-L, Sport Touring (5-Door)	Check the iN VIN status for eligibility.
2018	Civic	EX, Touring, Si (2-Door)	Check the iN VIN status for eligibility.
2018	Civic	EX, EX With Honda Sensing, EX-T, EX-A, Si (4-Door)	Check the iN VIN status for eligibility.
2018	Civic	LX,LX With Honda Sensing, EX, EX With Honda Sensing, Sport, EX-L, Sport Touring (5- Door)	Check the iN VIN status for eligibility.

BACKGROUND

Under certain circumstances, the vehicle may experience driveability issues which may result in DTCs P0300 (random misfire detected), P0301 (No. 1 cylinder misfire detected), P0302 (No. 2 cylinder misfire detected), P0303 (No. 3 cylinder misfire detected), P0304 (No. 4 cylinder misfire detected), or P0172 (fuel system too rich).

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

CUSTOMER NOTIFICATION

Owners of affected vehicles will be sent a notification of this campaign.

Do an iN VIN status inquiry to make sure the vehicle is shown as eligible.

Some vehicles affected by this campaign may be in your new or used vehicle inventory. Repair these vehicles before they are sold.

CORRECTIVE ACTION

Reset the maintenance minder, and replace only the engine oil. Inspect and replace the A/C control unit. Clear any DTCs, and update the PGM-FI and TCU software with the latest version. Reset the throttle position learned values, and do the PCM idle learn procedure.

WARRANTY CLAIM INFORMATION

Use this warranty information if your dealership participates in the bulk oil program.

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
1245A8	Reset the maintenance minder. Update the PGM-FI and TCU software. Replace the engine oil, the A/C control unit, and do the throttle position reset and PCM idle learn procedure. (Non Dual Zone A/C unit)	0.8 hr	6DV00	B3P00	A18137A	37805-5BA-A51

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
1245A8	Reset the maintenance minder. Update the PGM-FI and TCU software. Replace the engine oil, the A/C control unit, and do the throttle position reset and PCM idle learn procedure. (Dual Zone A/C unit)	<mark>0.8 hr</mark>	6DV00	B3P00	A18137B	37805-5BA-A51

Skill Level: Repair Technician

Use this warranty information if your dealership does not participate in the bulk oil program.

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
1245A8	Reset the maintenance minder. Update the PGM-FI and TCU software. Replace the engine oil, the A/C control unit, and do the throttle position reset and PCM idle learn procedure. (Non Dual Zone A/C unit)	<mark>0.8 hr</mark>	6DV00	B3P00	A18137C	37805-5BA-A51
Operation	Description	Flat Rate	Defect	Symptom	Template	Failed Part Number

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
1245A8	Reset the maintenance minder. Update the PGM-FI and TCU software. Replace the engine oil, the A/C control unit, and do the throttle position reset and PCM idle learn procedure. (Dual Zone A/C unit)	<mark>0.8 hr</mark>	6DV00	B3P00	A18137D	37805-5BA-A51

Skill Level: Repair Technician

PARTS INFORMATION

Part Name	Part Number	Quantity
Drain Plug Washer (14 mm)	94109-14000	1
Auto Air Conditioner CPU Assembly (A/C control unit) (Automatic Climate Control)	79610-TBA-A51	1
Auto Air Conditioner CPU Assembly (A/C control unit) (Dual-Zone Automatic Climate Control)	79610-TBC-A51	1

MATERIAL INFORMATION

Part Name	Part Number	Quantity
0W-20 (Bulk Oil Participants) (Gallons)	FS020-BAS-N0L	1
0W-20 (Non-Bulk Oil Participants) (Quarts)	08798-9063	4

SOFTWARE INFORMATION

NOTE

Unnecessary or incorrect repairs resulting from a failure to update the i-HDS are not covered under warranty.

i-HDS Software Version: 1.004.060 or later

J2534 Software Information:

- PC Application Version 1.1.0.6 or later
- Database update 12-DEC-2018 or later

Before beginning the repair, make sure that both the i-HDS and J2534 software are updated as listed above.

Do only the update listed in this service bulletin.

To update the software, you must use the MVCI or the DST-i interface in conjunction with the J2534 Rewrite PC application on the i-HDS.

For more information about updating the i-HDS, the MVCI, and vehicle systems, refer to service bulletin 01-023, *Updating Control Units/Modules*.

Year/Model	Software System	Program ID (or later)	Program P/N (or later)
2016 Civic (EX 2-Door, 4-Door)	PGM-FI	AAA580	37805-5AA-A58
	тси	5CGA080	28101-5CG-A08
2016 Civic (Touring 2-Door, 4-	PGM-FI	AAA680	37805-5AA-A68
Door)	тси	5CGA080	28101-5CG-A08
2016 Civic (EX 2-Door, 4-Door)	PGM-FI	AAL590	37805-5AA-L59
	тси	5CGA080	28101-5CG-A08
2016 Civic (Touring 2-Door, 4-	PGM-FI	AAL690	37805-5AA-L69
Door)	тси	5CGA080	28101-5CG-A08
2017 Civic (EX 2-Door, 4-Door) (M/T)	PGM-FI	AAA070	37805-5AA-A07
2017 Civic (EX 2-Door, 4-Door)	PGM-FI	AAA580	37805-5AA-A58
(CVT)	тси	5CGA080	28101-5CG-A08
2017 Civic (EX 2-Door, 4-Door)	PGM-FI	AAL590	37805-5AA-L59
	тси	5CGA080	28101-5CG-A08
2017 Civic (Touring 2-Door, 4-	PGM-FI	AAA680	37805-5AA-A68
Door)	тси	5CGA080	28101-5CG-A08
2017 Civic (Touring 2-Door, 4-	PGM-FI	AAL690	37805-5AA-L69
Door)	тси	5CGA080	28101-5CG-A08
2017 Civic (Si 2-Door, 4-Door) (M/T)	PGM-FI	AMA050	37805-5AM-A05


Year/Model	Software System	Program ID (or later)	Program P/N (or later)
2017 Civic (LX 5-Door) (M/T)	PGM-FI	AMA040	37805-5AN-A04
2017 Civic (LX 5-Door) (CVT)	PGM-FI	ANA540	37805-5AN-A54
	тси	CKA040	28101-5CK-A04
2017 Civic (LX w/Honda	PGM-FI	ANA750	37805-5AN-A75
Sensing 5-Door)	тси	CKA150	28101-5CK-A15
2017 Civic (LX 5-Door)	PGM-FI	ANL540	37805-5AN-L54
	тси	CKA040	28101-5CK-A04
2017 Civic (EX, EX-L 5-Door)	PGM-FI	AN9540	37805-5AN-954
	тси	CKA040	28101-5CK-A04
2017 Civic (EX, EX-L 5-Door)	PGM-FI	ANB540	67805-5AN-B54
	тси	CKA040	28101-5CK-A04
2017 Civic (Sport 5-Door) (M/T)	PGM-FI	ANA150	37805-5AN-A15
2017 Civic (Sport 5-Door) (CVT)	PGM-FI	ANA640	37805-5AN-A64
	тси	СКС040	28101-5CK-C04
2017 Civic (Sport 5-Door)	PGM-FI	ANL640	37805-5AN-L64
	тси	СКС040	28101-5CK-C04
2017 Civic (Sport Touring 5-	PGM-FI	ANA850	37805-5AN-A85
Door)	тси	CKC150	28101-5CK-C15
2018 Civic (Si 2-Door, 4-Door) (M/T)	PGM-FI	AMA050	37805-5AM-A05
2018 Civic (EX 2-Door) (EX-T 4- Door) (M/T)	PGM-FI	AAA110	37805-5AA-A11
2018 Civic (EX 2-Door) (EX-T 4-	PGM-FI	AAA720	37805-5AA-A72
Door) (CVT)	тси	GCA820	28101-5CG-A82
2018 Civic (EX 2-Door) (EX-T 4-	PGM-FI	AAL720	37805-5AA-L72
Door)	тси	GCA820	28101-5CG-A82
2018 Civic (Touring 2-Door)	PGM-FI	AAA820	37805-5AA-A82
(EX-T w/ Honda Sensing 4- Door)	тси	GCA820	28101-5CG-A82
2018 Civic (Touring 2-Door)	PGM-FI	AAL820	37805-5AA-L82
(EX-T w/ Honda Sensing 4- Door)	тси	GCA820	28101-5CG-A82


Year/Model	Software System	Program ID (or later)	Program P/N (or later)
2018 Civic (EX-A 4-Door)	PGM-FI	BAA510	37805-5BA-A51
	TCU	GCA820	28101-5CG-A82
2018 Civic (EX-A 4-Door)	PGM-FI	BAL410	37805-5BA-L41
	тси	GCA820	28101-5CG-A82
2018 Civic (EX w/ Honda	PGM-FI	AJA620	37805-5AJ-A62
Sensing 4-Door)	тси	GCA820	28101-5CG-A82
2018 Civic (EX w/ Honda	PGM-FI	AJL620	37805-5AJ-L62
Sensing 4-Door)	тси	GCA820	28101-5CG-A82
2018 Civic (EX Navigation 4-	PGM-FI	AJA520	37805-5AJ-A52
Door)	тси	GCA820	28101-5CG-A82
2018 Civic (EX Navigation 4-	PGM-FI	AJL520	37805-5AJ-L52
Door)	тси	GCA820	28101-5CG-A82
2018 Civic (LX 5-Door) (M/T)	PGM-FI	ANA040	37805-5AN-A04
2018 Civic (LX 5-Door) (CVT)	PGM-FI	ANA540	37805-5AN-A54
	тси	CKA040	28101-5CK-A04
2018 Civic (LX 5-Door)	PGM-FI	ANL540	37805-5AN-L54
	TCU	CKA040	28101-5CK-A04
2018 Civic (LX w/ Honda	PGM-FI	ANA750	37805-5AN-A75
Sensing 5-Door)	тси	CKA150	28101-5CK-A15
2018 Civic (LX w/ Honda	PGM-FI	ANL750	37805-5AN-L75
Sensing 5-Door)	TCU	CKA150	28101-5CK-A15
2018 Civic (EX, EX-L 5-Door)	PGM-FI	AN9540	37805-5AN-954
	тси	CKA040	28101-5CK-A04
2018 Civic (EX, EX-L 5-Door)	PGM-FI	ANB540	37805-5AN-B54
	тси	CKA040	28101-5CK-A04
2018 Civic (EX w/ Honda	PGM-FI	ANA950	37805-5AN-A95
Sensing 5-Door)	тси	CKA150	28101-5CK-A15
2018 Civic (EX w/ Honda	PGM-FI	ANA950	37805-5AN-L95
Sensing 5-Door)	тси	CKA150	28101-5CK-A15
2018 Civic (Sport 5-Door) (M/T)	PGM-FI	ANA150	37805-5AN-A15

Year/Model	Software System	Program ID (or later)	Program P/N (or later)
2018 Civic (Sport 5-Door) (CVT)	PGM-FI	ANA640	37805-5AN-A64
	TCU	CKC040	28101-5CK-C04
2018 Civic (Sport 5-Door)	PGM-FI	ANL640	37805-5AN-L64
	тси	CKC040	28101-5CK-C04
2018 Civic (Sport Touring 5-	PGM-FI	ANA950	37805-5AN-A95
Door)	тси	CKC150	28101-5CK-C15
2018 Civic (Sport Touring 5-	PGM-FI	ANL850	37805-5AN-L85
Door)	TCU	CKC150	28101-5CK-C15


REPAIR PROCEDURE

- 1. Reset the maintenance minder.
- 2. Drain and refill the engine oil. Do not replace the oil filter.
- 3. Replace the A/C control unit.
 - 3.1. Remove the dash side lid and the undercover.

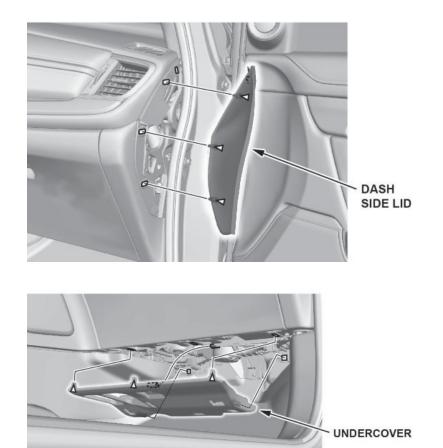

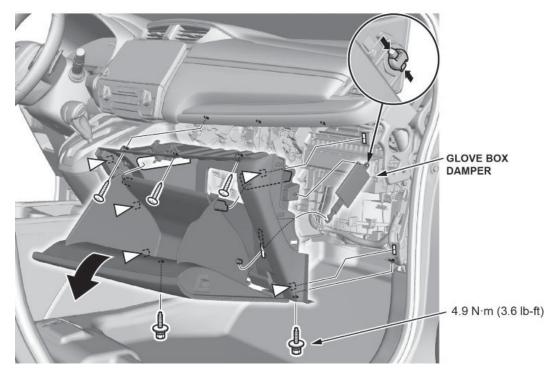

3.3. Remove and replace the A/C control unit.

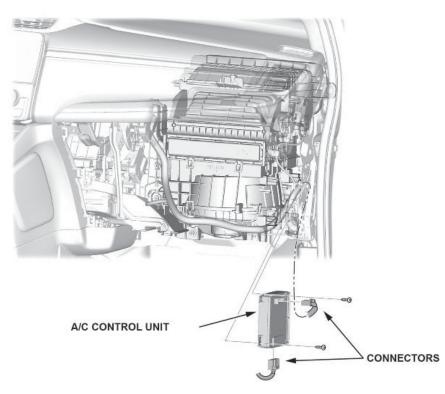

- 3.4. Install all parts in the reverse order of removal.
- 3.5. Run the HVAC self-diagnostics procedure with the i-HDS to make sure there are no problems in the system.

- 4. Use the i-HDS to update the PGM-FI and TCU software.
- 5. Update the PGM-FI and TCM software using the i-HDS J2534 rewrite software with the MVCI or DST-i. Refer to Service Bulletin 01-023, *Updating Control Units/Modules*.
- 6. Reset the throttle position learned values see then do the PCM idle learn procedure. Refer to the service information for additional instructions.

NOTE

For more information on the PCM idle learn procedure, see Tech2Tech video, "A Look at PCM Idle Learn".

END