



JTB00641NAS2

TECHNICAL BULLETIN

03 JAN 2019

© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

This reissue replaces all previous versions. Please destroy all previous versions.

Changes are highlighted in blue

SECTION:

413-13

SUBJECT/CONCERN:

Rear Proximity Camera Retaining Bracket Loose Or Adrift

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:
E-PACE (X540)	2018	Z00001-Z44410

MARKETS:

NORTH AMERICA

CONDITION SUMMARY:**SITUATION:**

The rear proximity camera retaining bracket may be loose or adrift, causing the image to be blank on the Touchscreen.

CAUSE:

This may be caused by the camera retaining bracket being incorrectly manufactured.

ACTION:

Should a customer express this concern, follow the Workshop Procedure below.

PARTS:

PART NUMBER	DESCRIPTION	QUANTITY
T2H15787	Rear proximity camera retaining bracket	1

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY: **NOTES:**

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Use TOPIx to obtain the latest repair time.
- The JLR claims submission system requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Rear proximity camera - Renew	86.62.48	0.3	33	T2H15787

 **NOTE:**

Normal Warranty procedures apply.

WORKSHOP PROCEDURE:

1

 **NOTE:**

At step 4 of the removal procedure, discard the bracket.

Remove the rear proximity camera (see TOPlx Workshop Manual section 413-13: Parking Aid - Removal and Installation - Rear Proximity Camera).

2

 **NOTE:**

At step 1 of the installation procedure, install a new bracket.

Install the rear proximity camera (see TOPlx Workshop Manual section 413-13: Parking Aid - Removal and Installation - Rear Proximity Camera).