

February 19, 2019

Version 1

Multiple Indicators On and Option Fuse (E21) Blown

AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2016-19	MDX	ALL	ALL

SYMPTOM

The vehicle may exhibit several of the following symptoms:

- Multiple indicators are on.
- The option fuse E21 (7.5 A) is blown.
- It is hard to shut off the engine.
- No communication with the i-HDS.

POSSIBLE CAUSE

Under certain conditions, the battery fan motor draws excessive current causing the option fuse to blow.

CORRECTIVE ACTION

Replace the battery fan motor and the option fuse.

PARTS INFORMATION

Part Name	Part Number	Quantity
Blower Assy., Battery Vent (Battery Fan Motor)	31651-TZ5-A02	1
Fuse (7.5A)	38221-SNA-A31	1

CLIENT INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Acura automobile dealer.

WARRANTY CLAIM INFORMATION

The normal warranty applies.


Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
7101A8	MDX - Replace the battery motor fan.	0.3 hr	06404	03214	B19005A	31651-TZ5-A01
737150	Replace the fuse.	0.1 hr				

Skill Level: Repair Technician

REPAIR PROCEDURE

1. Check the option fuse.

MDX

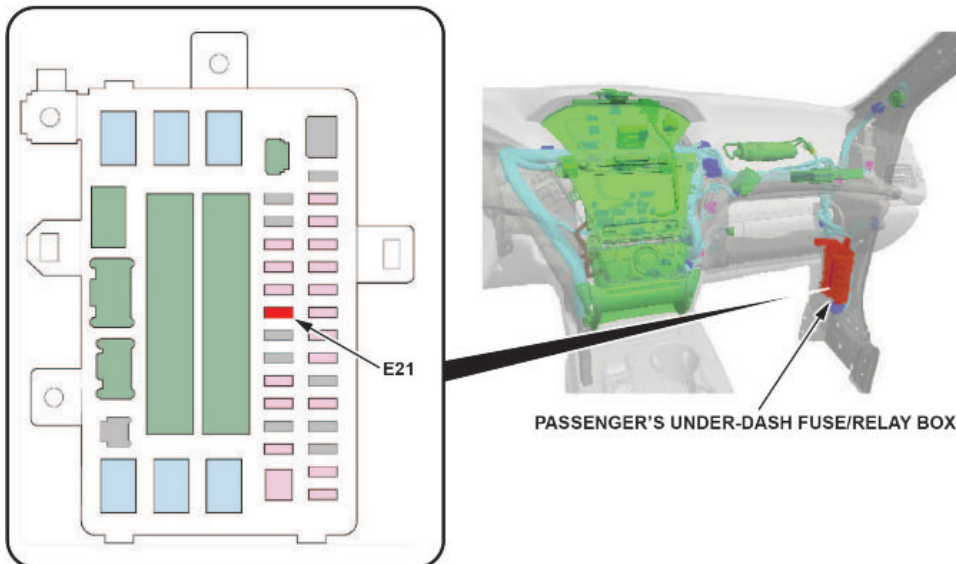

- If the option fuse is blown, replace the battery fan motor. Refer to the service information. Then go to step 2.
 - If the option fuse is not blown, this bulletin does not apply. Continue with normal system troubleshooting.
2. Replace the option fuse (7.5 A).

END