



TECHNICAL SERVICE BULLETIN

Illuminated MIL - DTC P0071 - Inaccurate Outside Temperature Readings - Front Parking Aid Sensor Inaccurate - Built On Or Before 4-Apr-2017

18-2342

16 January
2019

This bulletin supersedes 17-2140. Reason for update: Incorrect or Missing Parts

Model:

Lincoln
2017 Continental

Summary

This article supersedes TSB 17-2140 to update the Parts List.

Issue: Some 2017 Continental vehicles built on or before 4-Apr-2017 may exhibit an illuminated malfunction indicator lamp (MIL) with diagnostic trouble code (DTC) P0071, inaccurate outside temperature readings, front parking aid faults with DTC B1B42 and/or an inaccurate front parking aid system.

Action: Follow the Service Procedure steps to correct the condition.

Parts

Part Number	Description	Quantity
GD9Z-15K867-D	Wiring Harness (Vehicles With Active Park Assist And With 360 Degree View Camera)	1
GD9Z-15K867-C	Wiring Harness (Vehicles Without Active Park Assist And Without 360 Degree View Camera)	1
GD9Z-15K867-F	Wiring Harness (Vehicles With Active Park Assist And Without 360 Degree View Camera)	1

Warranty Status: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

Labor Times

Description	Operation No.	Time
2017 Continental Without 360 Degree Camera: Retrieve DTCs Inspect Connector And Replace The Wiring Harness Includes Time To Remove And Install The Bumper Cover (Do Not Use With Any Other Labor Operations)	182342A	1.2 Hrs.
2017 Continental With 360 Degree Camera: Retrieve DTCs Inspect Connector And Replace The Wiring Harness Includes Time To Remove And Install The Bumper Cover And Align 360 Degree Camera (Do Not Use With Any Other Labor Operations)	182342B	1.6 Hrs.

Repair/Claim Coding

Causal Part:	15K867
Condition Code:	42

Service Procedure

1. Using the appropriate Ford diagnostic scan tool or equivalent, retrieve DTCs. Are DTCs P0071 and/or B1B42 present along with inaccurate outside temperature readings, front parking aid faults, and/or an inaccurate front parking aid system?

(1). Yes - proceed to Step 2.

- (2). No - this article does not apply. Refer to Workshop Manual (WSM), Section 413-13.
2. Raise the vehicle. Refer to WSM, Section 100-02.
 3. Remove the lower radiator closeout panel. Refer to WSM, Section 501-19.
 4. Visually inspect connector C136 for water or corrosion. Refer to Wiring Diagram Manual, Cell 152-1. Is water or corrosion present in the connector?
 - (1). Yes - proceed to Step 5.
 - (2). No - this article does not apply. Refer to WSM, Section 413-13.
 5. Remove the front bumper cover. Refer to WSM, Section 501-19.
 6. Replace the 15K867 wiring harness located on the back side of the bumper cover.

© 2019 Ford Motor Company

All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.