

|           |   |
|-----------|---|
| SSM 47747 | Some 2015-2019 Transit vehicles may exhibit a power steering fluid leak at the steering pump or gear. This may be due to a cut or damaged O-ring on the power steering line connection. To repair, refer to parts catalog call out 3334 for service kit BK2Z-3F886-A which contains all four O-rings utilized on the line assembly connections. |
|-----------|---|