

Engine diagnosis warning lamp activated - Fault code P04F000

Topic number	LI47.30-P-069262
Version	1
Function group	47.30 Fuel evaporation control system
Date	01-08-2019
Validity	Model 205 with engine M264
Reason for change	
Reason for block	

Complaint:

Check Engine Lamp illuminates - The DTC P04F000 "Wide open throttle regeneration of the activated charcoal canister has a malfunction" is stored in the engine control unit.

Cause:

Wide open throttle purging hose has become disconnected from the intake system.

Remedy:

-Inspect wide open throttle purging hose located at front of engine (See attachment).

-If hose is found to be disconnected at either the top or the bottom, inspect seals on hose as well as retaining latches. Replace hose only if damage is found.

-Reconnect hose and verify proper connection by pulling on hose gently.

Attachments	
File	Description
Location of hose.png	Location of wide open throttle purging hose

Symptoms
Power generation / Engine management / Indicator lamp / Engine diagnosis / lit

Control unit/fault code		
Control unit	Fault code	Fault text
N3/10 - Motor electronics 'MED41' for combustion engine 'M260' (ME)	P04F000	Wide open throttle regeneration of the activated charcoal canister has a malfunction. _

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC

XENTRY TIPS

A 264 018 21 00		Purge Line	1	Only needed if damage is found	X
-----------------	--	------------	---	--------------------------------	---

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
54-1011	PERFORM QUICK TEST			
54-0650	ON-BOARD POWER SUPPLY VOLTAGE MAINTAIN			
09-8200	ENGINE AIR INTAKE DUCT UPS-TREAM OF AIR FILTER REPLACE		47144 38	

Validity		
Vehicle	Engine	Transmission
C (205) - 205.083	*	*
C (205) - 205.084	*	*
C (205) - 205.383	*	*
C (205) - 205.384	*	*
C (205) - 205.483	*	*
C (205) - 205.484	*	*