

Audio 20: Welcome light settings misadjusted after bus idle

Topic number	LI82.85-P-069261
Version	1
Function group	82.85 Navigation and Communication system (CNS, ICS, COMAND, FleetBoard)
Date	01-08-2019
Validity	MODEL 292, 166, 242, 156, 172, 117 with code 522 or 520 or 505
Reason for change	Validity adapted
Reason for block	

Complaint:

The "interior welcome light" setting changes from ON to OFF after a bus idle with no action by the customer.

Attachments	
File	Description
IMG_1513.JPG	Welcome light settings

Cause:

Possibly the software for the Audio20 control unit (A26/17).

Remedy:

Perform software update of head unit to software release E433.1 (18/31.40) or newer.

Note: The software will be available in the market in Q2 2019.

Symptoms
Lighting / Interior illumination / Interior lamp / Does not go on
Lighting / Interior illumination / Switch and controls illumination / Does not go on
Lighting / Interior illumination / Ambiance illumination / Does not go on

Control unit/fault code		
Control unit	Fault code	Fault text
A2 / A40/3 / A26/17 - Audio or COMAND (HU5_ENTRY)	-	-

Attachments

XENTRY TIPS

IMG_1513.JPG:

