

Title: VIN Glare Remedy

Applicability: MY18 Revero

Market Region: All

APPLICABILITY: On complaint

MARKET REGION: North America


PURPOSE: This will mitigate a VIN reflection on the windshield from the drivers field of view.

Overview:

1. Verify the VIN glare reflection from the driver seat position
2. Remove the valance panel from the dash pad top
3. Locate the VIN plate and the instrument panel bolt
4. Place the foam strip on the I/P lower location
5. Reassemble dash, ensuring the foam is not visible on the VIN window or through the dash panel

The tools as shown ,will be required to perform this set of inspections and adjustments.

- Panel tool
- Pick tool
- Foam Strip (C131140005300)

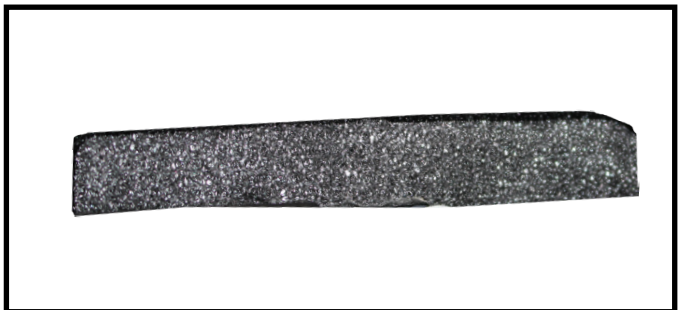

Karma Automotive Bulletins and service documents are intended for use by experienced and trained Technicians. If you lack the skills, tools, equipment and a suitable workshop for any procedure described in this document, we suggest you leave such repairs to a Karma retailer and service provider. See your service provider for advice on whether your vehicle may benefit from the information contained within this document. The information contained in the Karma Bulletin is accurate at the date of publication. However, Karma Automotive regularly updates technical information. Please check with your Karma Automotive Retailer and Karma Automotive service provider that the bulletin you intend to use contains the latest available information.

Title: VIN Glare Remedy

Applicability: MY18 Revero

Market Region: All

1. Verify the VIN glare into the cabin. This is seen over the steering wheel in front of the dash as shown below (fig. 1a).



fig. 1a

2. Remove the valance panel from the dash pad top using a panel tool (fig. 1b and 1c).



fig. 1b



fig. 1c

Karma Automotive Bulletins and service documents are intended for use by experienced and trained Technicians. If you lack the skills, tools, equipment and a suitable workshop for any procedure described in this document, we suggest you leave such repairs to a Karma retailer and service provider. See your service provider for advice on whether your vehicle may benefit from the information contained within this document. The information contained in the Karma Bulletin is accurate at the date of publication. However, Karma Automotive regularly updates technical information. Please check with your Karma Automotive Retailer and Karma Automotive service provider that the bulletin you intend to use contains the latest available information.

Title: VIN Glare Remedy

Applicability: MY18 Revero

Market Region: All

Proceed to remove this panel, taking care of scratching or marring the A pillar on removal (fig. 2a and 2b).



fig. 2a

Locate the VIN plate and the instrument panel bolt (fig. 2b), the bolt is the center point for the foam strip.



fig. 2b

Karma Automotive Bulletins and service documents are intended for use by experienced and trained Technicians. If you lack the skills, tools, equipment and a suitable workshop for any procedure described in this document, we suggest you leave such repairs to a Karma retailer and service provider. See your service provider for advice on whether your vehicle may benefit from the information contained within this document. The information contained in the Karma Bulletin is accurate at the date of publication. However, Karma Automotive regularly updates technical information. Please check with your Karma Automotive Retailer and Karma Automotive service provider that the bulletin you intend to use contains the latest available information.

Title: VIN Glare Remedy**Applicability: MY18 Revero****Market Region: All**

3. Peel back a quarter or half of the adhesive cover for the strip and apply to the panel (fig 3a). Use the pick tool as needed to aid in manipulating the foam into position.

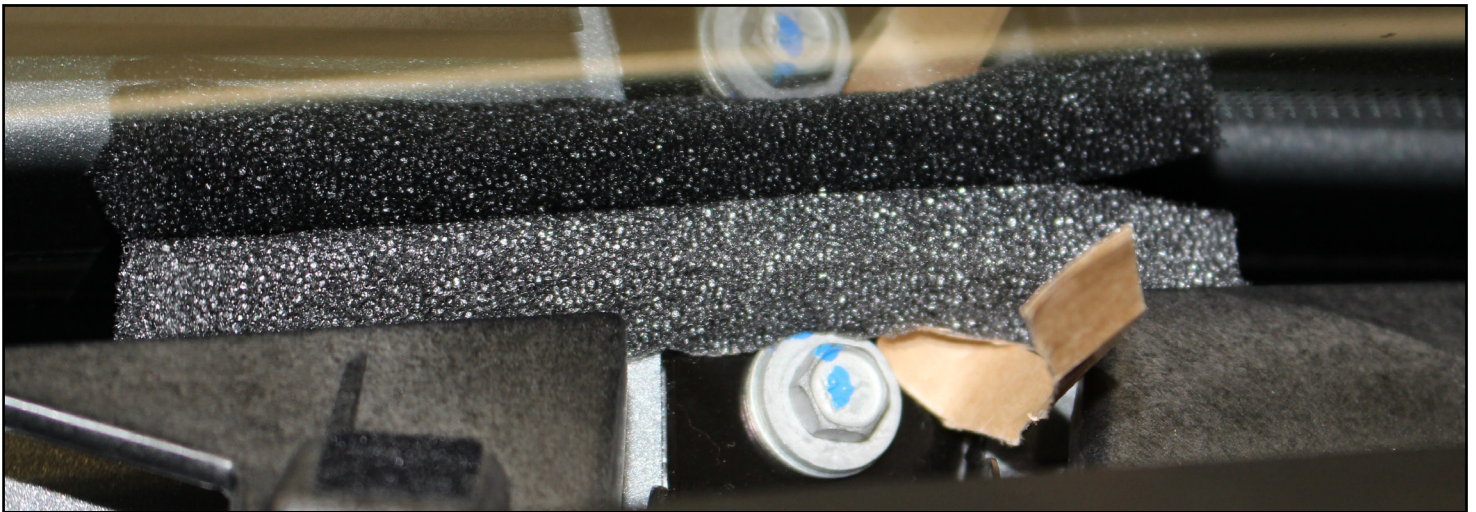


fig. 3a

The foam strip is located properly as shown (fig. 3b).



fig. 3b

Karma Automotive Bulletins and service documents are intended for use by experienced and trained Technicians. If you lack the skills, tools, equipment and a suitable workshop for any procedure described in this document, we suggest you leave such repairs to a Karma retailer and service provider. See your service provider for advice on whether your vehicle may benefit from the information contained within this document. The information contained in the Karma Bulletin is accurate at the date of publication. However, Karma Automotive regularly updates technical information. Please check with your Karma Automotive Retailer and Karma Automotive service provider that the bulletin you intend to use contains the latest available information.

Title: VIN Glare Remedy

Applicability: MY18 Revero

Market Region: All

4. Verify the foam strip does not peak into the VIN window from the windshield side (fig. 4a). Adjust as needed, and reassemble the dash.



fig. 4a

The VIN glare is no longer visible as seen below (fig. 4b).



fig. 4b

Karma Automotive Bulletins and service documents are intended for use by experienced and trained Technicians. If you lack the skills, tools, equipment and a suitable workshop for any procedure described in this document, we suggest you leave such repairs to a Karma retailer and service provider. See your service provider for advice on whether your vehicle may benefit from the information contained within this document. The information contained in the Karma Bulletin is accurate at the date of publication. However, Karma Automotive regularly updates technical information. Please check with your Karma Automotive Retailer and Karma Automotive service provider that the bulletin you intend to use contains the latest available information.

Type: Technical Service Bulltein

Year: 2019

System: Interiors (82)

Sequence: 01

First Release Rev: 0.1

Title: VIN Glare Remedy

Applicability: MY18 Revero

Market Region: All

PARTS IF REQUIRED:

PART NUMBER	DESCRIPTION	QTY
C131140005300	Assembly - Plenum Foam Panel LH	1

SHOP SUPPLIES:

PART NUMBER	DESCRIPTION	QTY
N/A	N/A	

SPECIAL TOOLS:

DESCRIPTION

CAUSAL PART:

PART NUMBER	DESCRIPTION
C131140102002CC*	Panel Assembly - Valance

*Choose your vehicle interior color to replace the "CC" deignator for the causal part

KA = Black Sand	MB = Clay	NK = Beach
-----------------	-----------	------------

LABOR CODES:

CODE	DESCRIPTION	TIME	DEFECT CODE
80-20-02-05	VIN glare remedy	0.3	80-20-02-13

SUBLET:

CODE	DESCRIPTION	AMOUNT
N/A		

WARRANTY DISPOSITION: This repair is covered under the New Vehicle Limited Warranty, in effect for five (5) years from the in-service date with no mileage limitation.

Karma Automotive Bulletins and service documents are intended for use by experienced and trained Technicians. If you lack the skills, tools, equipment and a suitable workshop for any procedure described in this document, we suggest you leave such repairs to a Karma retailer and service provider. See your service provider for advice on whether your vehicle may benefit from the information contained within this document. The information contained in the Karma Bulletin is accurate at the date of publication. However, Karma Automotive regularly updates technical information. Please check with your Karma Automotive Retailer and Karma Automotive service provider that the bulletin you intend to use contains the latest available information.