

SERVICE BULLETIN

Reference number:	SB-09-1218	Issued: 28 January, 2019
Subject:	Loose Exhaust Finishers	
Model(s):	Vantage 19MY	
VIN Range:	All	
Applicable to:	All Dealers	
Distribute to:	After Sales Manager Executive Manager Service Manager Sales Manager	Warranty Staff Technician(s) Parts Staff

Reason for this Service Bulletin

Some Vantage 19MY vehicles with twin and quad exhaust finishers can become loose. Do the procedure that follows to check and, if necessary, remove unwanted material from the exhaust finisher so it can be installed correctly:

Workshop Procedure

1. Do a push pull test of each exhaust finisher to check if it is loose.
2. If an exhaust finisher is loose, remove the exhaust finisher from the vehicle (refer to Workshop Manual Procedure 01.19.BX).
3. Each exhaust finisher has two slots (refer to Figure 1).

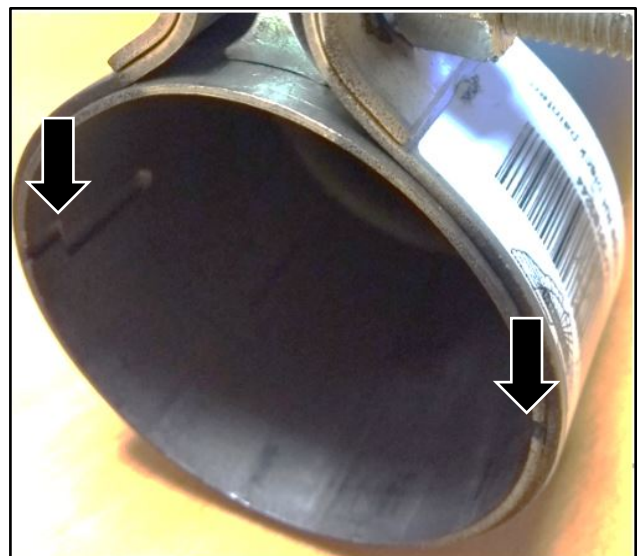


Figure 1

4. Use an applicable tool to cut 1mm of exhaust finisher material from the area shown (refer to Figure 2).

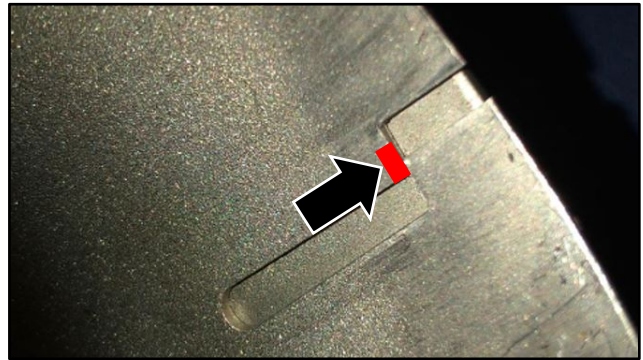


Figure 2

5. Install the exhaust finisher to the vehicle (refer to workshop manual procedure 01.19.BX).

Note: Do a push and pull test of each exhaust finisher to check if it is installed correctly before the bumper is installed.

Warranty Data

Procedure and Labour Time

Description	Labour Time
Inspect the exhaust finishers	0.5
Remove, modify and install the exhaust finishers	2.5

If you have any questions related to this Service Bulletin, please contact: Aston Martin Technical Services
on: +44 (0) 1926 644720, email: askamtech@astonmartin.com,
Or contact your After Sales Manager.

The English version of this Service Bulletin is written in
Simplified Technical English to ASD-STE100™.