



# Preliminary Information

## PIP5540D Diagnostic Tip: Poor Engine Performance Or CEL On In Cold Ambient Temperatures On Vehicles Equipped With Turbocharged Gasoline Engines May Set One Or More Of The Following DTCs P0299 P2227

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
All	All	2000 - 2019	All	All	All	All

Involved Region or Country	North America
Condition	CEL on and poor engine performance in very cold ambient temperatures.
Cause	Possible poor engine performance with one or more of the following DTC's set due to restricted air flow during times of very cold ambient temperatures. (P0299, P2227)

Correction:

If you encounter one or more of the following DTC's P0299, P2227 or poor engine performance during very cold ambient temperatures of 32 degrees Fahrenheit (0 degrees Celsius) or lower.

**Important: Before proceeding, please verify that all the latest service information including bulletins and PI's that pertain to this issue have been completed for the specific vehicle being serviced.**

Inspect the air induction system including charge air cooler on turbocharged engines for signs of ice restricting the air flow or covering related pressure sensors.

If found, allow the ice to melt so that the moisture can be drained from the induction system including the charge air cooler without component damage.

Once any excessive moisture has been removed, retest and follow normal diagnostic steps for any symptoms found.

Version History

Version4	5
Modified	<p>01/04/2018 - Created on</p> <p>01/18/2018 - Updated Title, Cause and Correction Section.</p> <p>12/06/2018 Updated to add 2019 model year</p> <p>01/11/2019- Updated to remove dtc P0171 P0172</p> <p>02/19/2019- Updated to change PI to diagnostic tip and added additional information advising dealer to complete all latest bulletin's pertaining to specific vehicle being serviced.</p>



GENERAL MOTORS

© 2019 General Motors. All Rights Reserved.