

Date	Expiration	Release	Page
12.2018	12.2020	2	1(3)

Revision: A Two (2) vehicles added to the list 02-05-19

STEERING COLUMN UNIVERSAL JOINT VISUAL INSPECTION

Prevost vehicles

DESCRIPTION

On the vehicles affected by this bulletin, an inspection of the upper steering column universal joint must be performed.

MODEL YEAR(S) AND VEHICLES INVOLVED

NOTICE TO SERVICE CENTERS	
Verify vehicle eligibility by checking warranty bulletin status with SAP or via ONLINE WARRANTY SYSTEM available on Service / Warranty tab of Prevost website.	
Model	VIN
H3-45 coaches Model Year : 2019	2PCH33494 <u>KC710485</u>
	2PCH33496 <u>KC710486</u>
	2PCH33498 <u>KC710487</u>
	2PCH33493 <u>KC710493</u>
	> 2PCH33495 <u>KC710494</u>
	2PCH33490 <u>KC710497</u>
	>2PCH33492 <u>KC710498</u>
This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery.	

PROCEDURE


DANGER


Park vehicle safely, apply parking brake, stop the engine. Prior to working on the vehicle, set the ignition switch to the OFF position and trip the main circuit breakers equipped with a trip button. On Commuter type vehicles, set the battery master switch (master cut-out) to the OFF position.

Date	Expiration	Release	Page
12.2018	12.2020	2	2(3)

VISUAL INSPECTION

1. Perform a visual inspection of the steering column. First, remove the plastic covers.
2. Make sure that the upper shaft is properly and fully engaged in the yoke. The yoke must rest against the upper shaft shoulder.

NOT CORRECT

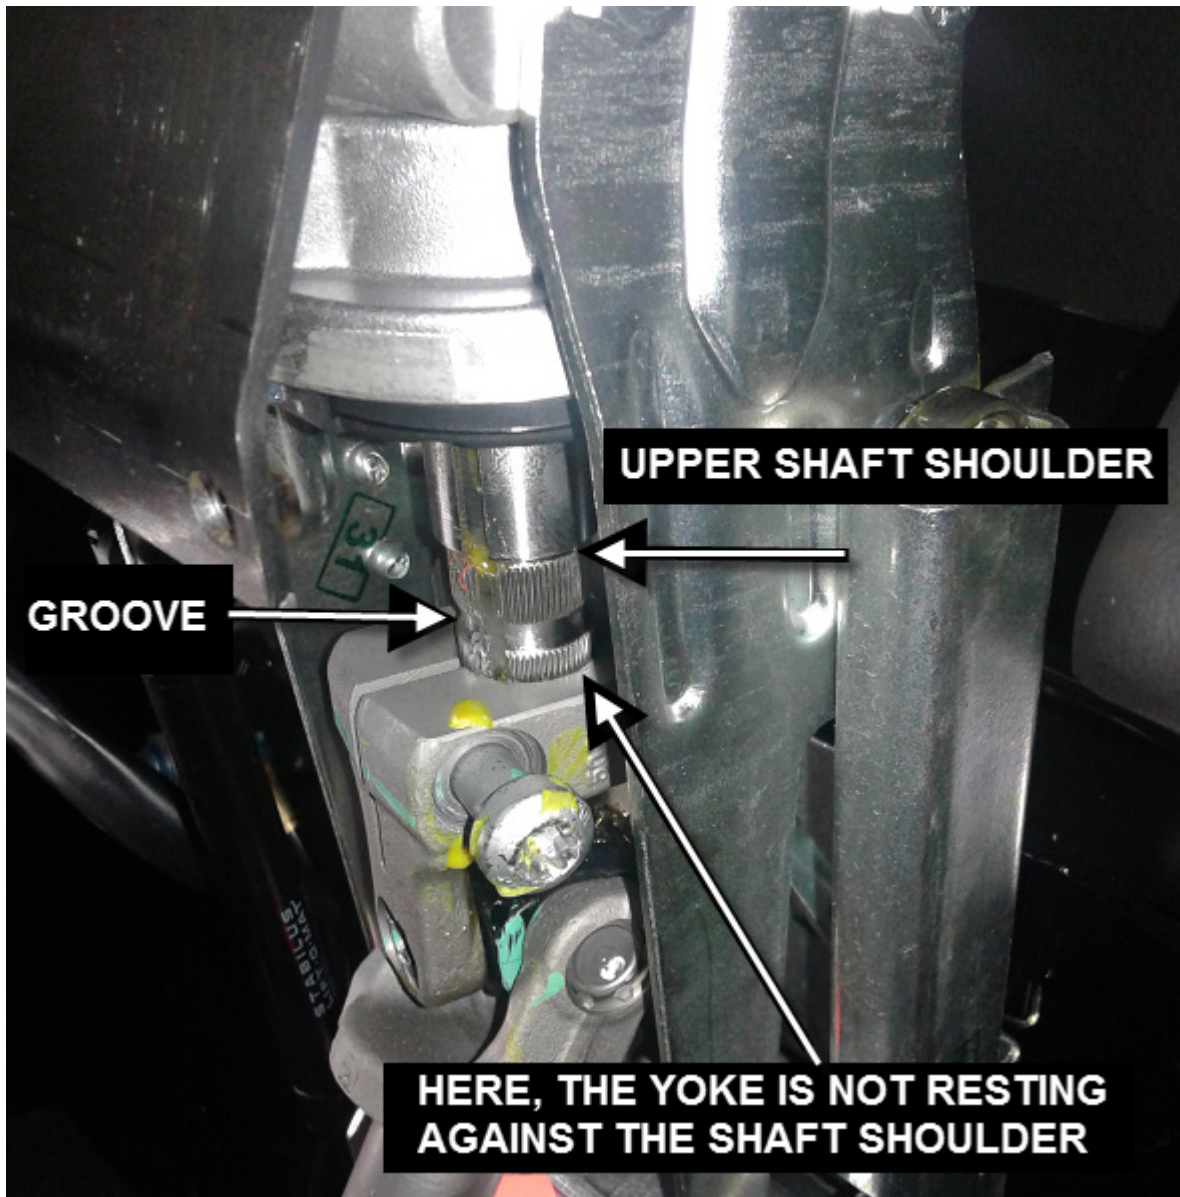

Date	Expiration	Release	Page
12.2018	12.2020	2	3(3)

3. IF THE YOKE IS NOT PROPERLY RESTING AGAINST THE UPPER SHAFT SHOULDER, loosen the pinch bolt.
4. Make sure that the shaft is properly inserted in the yoke bore and that the yoke is pressed against the shaft shoulder. To prevent the yoke from disengaging, the bolt fits in a groove (see picture above).

Tighten the pinch bolt to: **46 lbf-ft**

5. Apply torque seal mark.
6. Reinstall the steering column covers.

ESTIMATED TIME

The time required to perform this special bulletin is ½ hour.

OTHER

VBC Bulletin	N/A
Fail Code	14.07
Defect Code	09
Syst. Cond	B
Causal Part	660770

Access all our Service Bulletins on
<http://techpub.prevostcar.com/en/>
or scan the QR-Code with your smart phone.



Prevost engages in a continuous program of testing and evaluating to provide the best possible product. Prevost, however, is not committed to, or liable for updating existing products.