

March 7, 2019

Version 2

Multiple Indicators On and Option Fuse (E21 or B7) Blown

Supersedes 19-005, dated February 19, 2019, to revise the information highlighted in **yellow**

AFFECTED VEHICLES

| Year | Model | Trim | VIN Range |
|---------|------------------|------|-----------|
| 2016-19 | MDX | ALL | ALL |
| 2017-19 | MDX Sport Hybrid | ALL | ALL |
| 2018-19 | TLX | V6 | ALL |

REVISION SUMMARY

- Under AFFECTED VEHICLES, models and were added.
- 2018-19 TLX information was added.

SYMPTOM

The vehicle may exhibit several of the following symptoms:

- Multiple indicators are on.
- No communication with the i-HDS.
- The option fuse (7.5 A) is blown.
 - MDX: Fuse E21
 - TLX: Fuse B7
- MDX: It is hard to shut off the engine.
- TLX: The transmission will not shift from park.

POSSIBLE CAUSE

Under certain conditions, the battery fan motor draws excessive current causing the option fuse to blow.

CORRECTIVE ACTION

Replace the battery fan motor and the option fuse.

NOTE

Be sure to replace the correct fuse for the model you are working on.

CLIENT INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Acura automobile dealer.

PARTS INFORMATION

| Part Name | Part Number | Quantity |
|--|---------------|----------|
| Blower Assy., Battery Vent (Battery Fan Motor) (MDX) | 31651-TZ5-A02 | 1 |
| Blower Assy., Battery Vent (Battery Fan Motor) (TLX) | 31651-TZ3-A02 | 1 |
| Fuse (7.5 A) | 38221-SNA-A31 | 1 |

WARRANTY CLAIM INFORMATION

The normal warranty applies.

| Operation Number | Description | Flat Rate Time | Defect Code | Symptom Code | Template ID | Failed Part Number |
|------------------|--------------------------------------|----------------|-------------|--------------|-------------|--------------------|
| 7101A8 | MDX - Replace the battery motor fan. | 0.3 hr | 06404 | 03214 | B19005A | 31651-TZ5-A01 |
| 737150 | Replace the fuse. | 0.1 hr | | | | |


| Operation Number | Description | Flat Rate Time | Defect Code | Symptom Code | Template ID | Failed Part Number |
|------------------|--------------------------------------|----------------|-------------|--------------|-------------|--------------------|
| 7101A8 | TLX - Replace the battery motor fan. | 0.3 hr | 06404 | 03214 | B19005B | 31651-TZ3-A01 |
| 737150 | Replace the fuse. | 0.1 hr | | | | |

Skill Level: Repair Technician


REPAIR PROCEDURE

1. Check the option fuse.

MDX

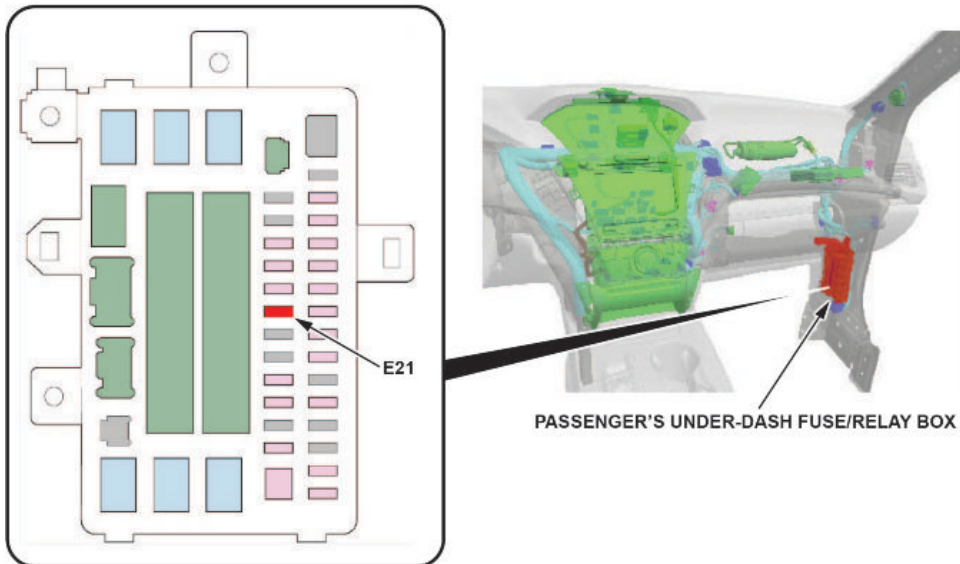

TLX

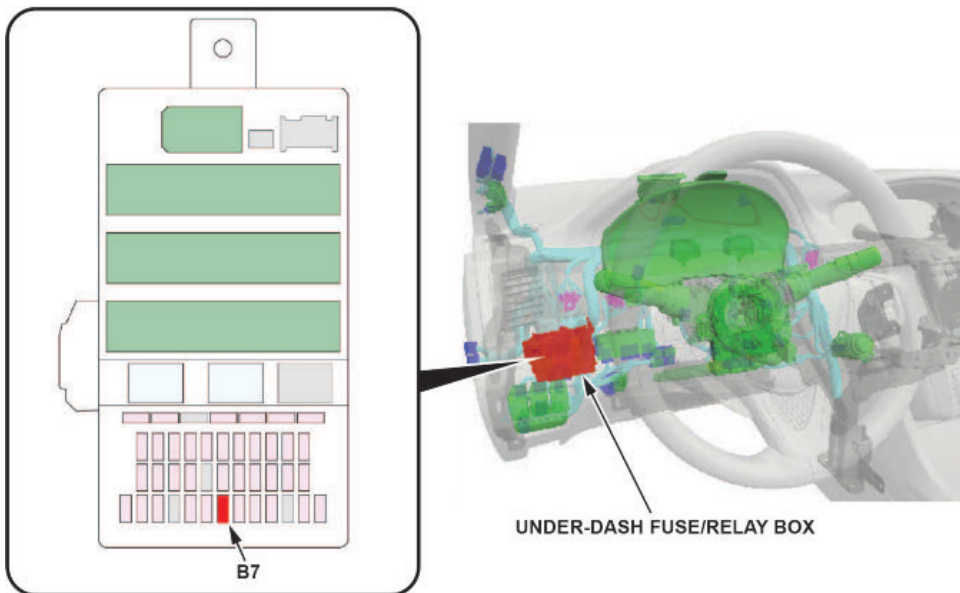

- If the option fuse is blown, replace the blower fan motor. Refer to the service information. Then go to step 2.
- If the option fuse is not blown, this bulletin does not apply. Continue with normal system troubleshooting.

2. Replace the option fuse (7.5 A).

END