

Technical Service Bulletin

Mazda North American Operations
Irvine, CA 92618-2922



Subject: FRONT CAMERA SENSOR SYSTEM MALFUNCTION WARNING MESSAGE IN INSTRUMENT CLUSTER AND DTC U0155:00 STORED	Bulletin No.: 15-001/19
	Last Issued: 03/04/2019

BULLETIN NOTES

This bulletin supersedes the previously issued bulletin(s) listed below. The changes are noted in Red text.

Previous TSBs:	Date(s) Issued:
15-001/19	01/30/2019



APPLICABLE MODEL(S)/VINS

2017-2018 CX-5 vehicles with VINs lower than JM3KF*****337821 (produced before Dec. 26, 2017)

DESCRIPTION

Some vehicles may experience a SBS/SCBS, LAS/LDWS and/or ADAPTIVE LED headlight /HBC warning light on with the DTC U0155:00 stored in memory. The warning lights may stay on while these functions are deactivated.

- DTC U0155:00 - Communication error to instrument cluster.

		
SMART BRAKE SUPPORT/SMART CITY BRAKE SUPPORT (SBS/SCBS) WARNING LIGHT	LANE DEPARTURE WARNING SYSTEM (LDWS) WARNING LIGHT (IF EQUIPPED)	ADAPTIVE LED HEADLIGHTS/HBC WARNING LIGHT (IF EQUIPPED)

This concern may be caused by faulty Instrument Cluster software. To eliminate this concern, the software has been modified.


NOTE: The Mazda Diagnostic Reprogramming Tool (MDRT) loaner program begins effective Jan. 30, 2019.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

REPAIR PROCEDURE

1. Verify customer concern.
2. Order loaner MAZDA DIAGNOSTIC REPROGRAMMING TOOL (MDRT) via Mazda eStore.
3. Prepare MDRT to reprogram the Instrument Cluster (IC) software.

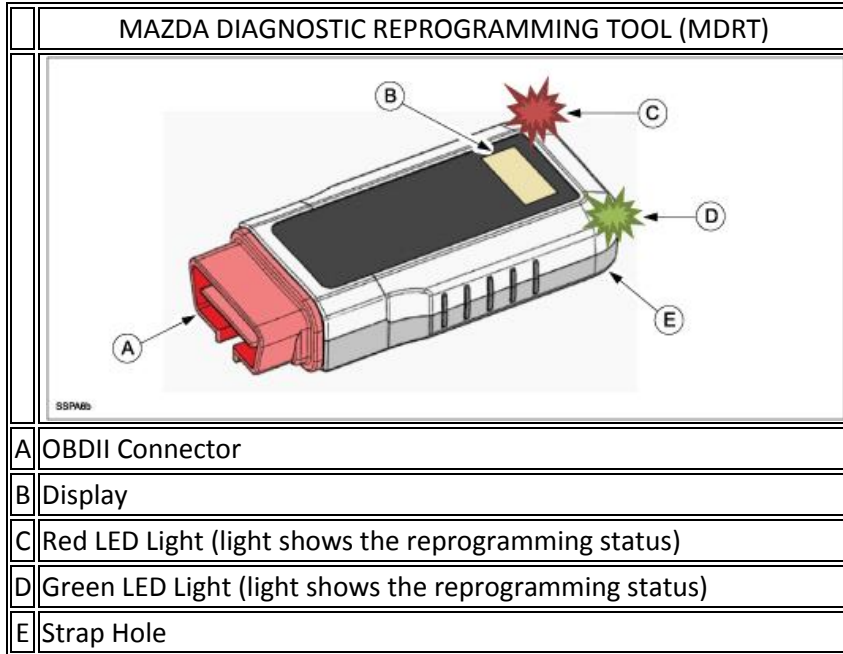

NOTE: Before performing IC unit reprogramming with MDRT:

- Turn off all electric loads (i.e. air-conditioning, audio system etc.), then connect a battery charger to the vehicle battery.
- **DO NOT** touch the reprogramming tool while the green light is blinking (with a frequent beeping sound).
- During the reprogramming, the center display and instrument cluster may blink. This is normal.
- Place the advanced key on the center console.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

CAUTION:

- MDRT equipment is sensitive. Handle it gently and avoid disassembly, impact, heat or liquids.


To avoid IC unit damage during reprogramming, otherwise, IC unit replacement may be necessary:

- Do not disconnect the MDRT from the OBDII connector.
- Do not start the engine during reprogramming.
- Do not turn the ignition off during reprogramming.

4. Follow Steps 1 - 8 in the table below to reprogram the IC unit:

Step	Technician Operation	Vehicle Status	MDRT Status	LED Status		Beep Sound	Display	MDRT Removal
				Green	Red			
1	Prepare MDRT	IG-OFF	---	OFF	OFF	---	(None)	---
2	Connect MDRT to vehicle		Connected	ON	ON	One long beep	Ready	Allowed
3	Turn IG-ON (engine OFF)	IG-ON Batt. Voltage: 10.5V or higher	System checking	Blink	OFF	Beeping at intervals	Checking	Prohibited (for 1-2 min)
4	Monitoring MDRT		Start reprogramming	Flash	OFF	Beeping at intervals	Running	
5	Monitoring MDRT		Reprogramming	Blink	OFF	Beeping at intervals	Running	
6	Monitoring MDRT		Finish reprogramming	ON	Blink	Beeping at irregular intervals	Repro OK 084301	Not recommended
7	Turn IG-OFF	IG-OFF	Connected	ON	Blink	Beeping at irregular intervals	Repro OK 084301	Not recommended
8	Disconnect MDRT		Disconnected	OFF	OFF	No beeping	(None)	Allowed

 NOTE: When the IC unit reprogramming has successfully completed, the MDRT display alternates the messages "Repro OK" 084301", "Repro OK", "Repro OK HEC.C".



CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

If "Repro OK DTC!!" is displayed at Step 6, check DTCs with M-MDS and repair the DTC(s) according to the instructions on MGSS online.



OCCURANCE EXAMPLE:

The following warning lights may illuminate and DTC (B115E:54) may be stored.

DTC B115E:54: Forward sensing camera (FSC) aiming not completed.

<p>SMART BRAKE SUPPORT/SMART CITY BRAKE SUPPORT (SBS/SCBS) WARNING LIGHT</p>	<p>LANE DEPARTURE WARNING SYSTEM (LDWS) WARNING LIGHT (IF EQUIPPED)</p>	<p>ADAPTIVE LED HEADLIGHTS/HBC WARNING LIGHT (IF EQUIPPED)</p>

NOTE: If DTC B115E:54 is stored in memory, carry out FSC aiming according to the instructions on MGSS online.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

TROUBLESHOOTING

NOTE:

- The step numbers below are related to the step numbers in the IC unit Reprogramming Procedure table.
- The most possible causes are in **bold**.

Step	Technician Operation	Vehicle Status	MDRT Status	LED Status		Beep Sound	Display
3-1	IG-ON	IG-ON	MDRT malfunction	G	OFF	Continuously beeping	Data NG
				R	Illuminate		---
3-2	IG-ON with MDRT not securely connected	IG-ON	No power supplied	G	OFF	No Beep	---
				R	OFF		---
3-3	Start engine	Engine run	Check battery voltage. Stop reprogramming	G	OFF	Beeping for 1 sec.	Repro NG
				R	Illuminate		PPRO_NG
4-1	IG-ON	Not a subject vehicle	MDRT performs only deleted DTC	G	OFF	Continuously beeping	VIN_NG
				R	Blinking at 1 sec. intervals		No Target
4-2	IG-ON	IG-ON Battery Voltage: 11V or lower. SOC: 75% or lower	Check battery voltage. Stop reprogramming	G	OFF	Continuously beeping	Repro NG
				R	Blinking at 1 sec. intervals		BATCHK
5	Poor MDRT connection during reprogramming	IG-ON	No power supplied	G	OFF	No Beep	---
				R	OFF		---
6-2	Monitor	IG-ON	Reprogramming complete. DTC cannot be detected	G	OFF	Continuously beeping	Repro OK
				R	Blinking at 1 sec. intervals		DTC!!

NOTE:

- No. 4-1: Verify that the VIN and production date are within the ranges.
- No. 3-1 or No. 6-2: May be caused by the following:
 - The data in the IC unit is faulty
 - The MDRT has a malfunction

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

PARTS INFORMATION

Special Service Tool (SST)

SST	Notes
Mazda Diagnostic Reprogramming Tool (MDRT)	Order loaner MDRT via Mazda eStore

NOTE: The Mazda Diagnostic Reprogramming Tool (MDRT) loaner program begins effective Jan. 30, 2019.

ORDERING Mazda Diagnostic Reprogramming Tool:

- Dealer **MUST HAVE** customer's vehicle in the shop before placing the order
- **Description:** Mazda Diagnostic Reprogramming Tool (MDRT)
- **Part Number:** 9999-95-MDRT-L
- Place loaner MDRT order via Mazda e-Store
- Bosch will contact the dealer to confirm the customer's vehicle is in the shop. Once confirmed, the MDRT order will ship UPS Next Day delivery
- Shipment will contain a UPS Next Day Air return shipping label

RETURNING Mazda Diagnostic Reprogramming Tool:

- Loaner MDRT must be shipped back the day after dealer receives it (two (2) days from initial ship date from Bosch)
- Dealer **MUST** use the UPS Next Day Air return label provided in the shipment
- **If MDRT loaner tool is not returned on time, dealer will be invoiced \$1,000.00**

NOTE: MDRT loaner tool will ship from / to Bosch Automotive Services.

NOTE: If your MDRT is defective or unable to be used, do not place another order on e-Store. Send an email with your Dealer Number and Order Number to smsrepair@us.bosch.com, ray.deschepper@us.bosch.com and theresa.smith@us.bosch.com and another tool will be sent to you immediately.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

	IC Reprogramming
Warranty Type	A
Symptom Code	62
Damage Code	9W
Part Number Main Cause	KL2L-55-430B
Quantity	0
Operation Number / Labor Hours:	XXP7ZAFX / 0.2 Hrs
Sublet Code:	Z9
Sublet Amount:	\$80.00

NOTE:

- A copy of the entire Bosch invoice must be attached using the D14 attachment ID. Failure to do so will result in claim rejection.
- Due to the unique nature of these claims, all accepted claims will pend for adjuster review.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.