



Service Bulletin

Bulletin No.: 18-NA-086

Date: February, 2019

TECHNICAL

Subject: Service Driver Assist System Message Displayed on Driver Information Center (DIC), Malfunction Indicator Lamp (MIL) Illuminated - DTC B172E Set

This Bulletin replaces PIT5590B. Please discard PIT5590B.

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Enclave	2018	2018				
	LaCrosse	2017					
Cadillac	XT5	2017					
Chevrolet	Equinox	2018					
GMC	Acadia	2017					
	Terrain	2018					

Involved Region or Country	North America and N.A. Export Regions
Condition	<p>Some customers may comment on the following conditions:</p> <ul style="list-style-type: none"> • MIL is illuminated • Service Driver Assist System message displayed on DIC <p>Some technicians may find DTC B172E (Driver Seat Cushion Left Rear Haptic Movement) set as history in the Seat Memory Control Module.</p>
Cause	This condition may be caused by electrical back feed from the lane departure warning actuator.
Correction	<p>If you encounter a vehicle with the above concern, replace both driver side Front Seat Lane Departure Warning Actuators.</p> <p>⇒ A capacitor has been added to the new lane departure warning actuator to prevent the back-feed that is causing the code to set.</p>

Service Procedure

Refer to *Front Seat Lane Departure Warning Actuator Replacement* in SI.

Parts Information

Causal Part	Description	Part Number	Qty
x	ACTUATOR, F/SEAT LANE DEPARTURE WRNG	84458512 (Enclave)	2
		84456076 (Acadia, Equinox, Terrain, XT5)	
		26271513 (LaCrosse)	

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Vehicle	Labor Time
6480468*	Both Driver Side Front Seat Lane Departure Warning Actuators Replacement	Enclave	1.2 hrs
		LaCrosse	1.3 hrs
		XT5	1.2 hrs
		Equinox	1.4 hrs
		Acadia	1.3 hrs
		Terrain	1.4 hrs

*This is a unique Labor Operation for Bulletin use only.

Version	3
Modified	Released June 07, 2018 July 20, 2018 – Updated Model Years and Warranty Information section. February 05, 2019 – Added the LaCrosse model/information.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION