



# Service Bulletin

Bulletin No.: 17-NA-154

Date: February, 2019

## TECHNICAL

**Subject:** Service Side Object Detection Message Displayed on Driver Information Center (DIC)

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Impala (VIN 1)	2014	2015				

<b>Involved Region or Country</b>	North America, South Korea, Middle East, Israel
<b>Additional Options (RPOs)</b>	UFT (SENSOR INDICATOR-SIDE OBSTACLE DETECTION) UKC (SIDE ACTIVE SAFETY-OBSTACLE DETECTION ENHANCED)
<b>Condition</b>	Some customers may comment that the Service Side Detection message is displayed on the DIC. Some customers may also comment that the side mirror indicators are either never illuminate or are always illuminated.
<b>Cause</b>	This condition may be caused by water entering the wiring harness and side object sensing alert modules during thermal cycles.
<b>Correction</b>	If water and/or corrosion has been validated in the wiring harness and/or the side object sensing alert modules, both the harness and modules (LH and RH) need to be replaced.

### Service Procedure

Refer to *Side Object Sensing Alert Module Replacement* and *Rear Object Sensor Wiring Harness Replacement* in SI.

### Parts Information

Description	Year	Part Number	Qty
MODULE, SIDE OBJECT SENSING ALERT	2014–2017	Refer to the Electronic Parts Catalog (EPC)	1
HARNESS, RR OBJECT ALARM SEN WRG	2014–2015	23230435	1
HARNESS, RR OBJECT ALARM SEN WRG	2016–2017	23188323	1

## Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
6420380	Side Object Sensing Alert Module Replacement	Use Published Labor Operation Time

Version	2
Modified	Revised February 21, 2019 - Added UKC to Additional Options RPO section, added side mirror indicator issue in the Conditions section and removed 2016 and 2017 model years.

