



GROUP
Chassis

MODEL
2019MY
Forte (BDm)

NUMBER
PS592

DATE
February 2019



TECHNICAL OPERATIONS

SUBJECT:

BRAKE WARNING LAMP ILLUMINATED

This Pitstop provides information regarding a possible brake warning lamp illumination on the instrument cluster on 2019MY Forte (BDm) vehicles, produced on or prior to December 20, 2018. If the fluid level is correct, unplug the brake fluid level indicator switch connector (E404) and note if the brake warning lamp is no longer illuminated. If the lamp is no longer illuminated, replace the brake fluid level indicator switch only. The switch is available separately from the master cylinder. Ensure the brake fluid level indicator switch is replaced instead of replacing the master cylinder. Replacement of the master cylinder instead of the switch may result in a chargeback.



Part Name	Part Number	Figure
Brake Fluid Level Indicator Switch Assembly	58535 A5000	