

QUARANTINE NOTICE

Reference number:	QN-03-1159	Issued: 26 February, 2019
Subject:	Bonnet-Vent Water Shields	
Model(s):	DB11 V12	
VIN Range:	Refer to the separately published list of affected Vehicle Identification Numbers (VINs)	
Applicable to:	All Dealers	
Distribute to:	After Sales Manager Executive Manager Service Manager Sales Manager	Warranty Staff Technician(s) Parts Staff

Note: *This repair is the same as Service Action SA-03-1159. Use this Quarantine Notice for vehicles that are not registered and have not been given to a Customer.*

Some vehicles in the affected VIN list for this Quarantine Notice may now be registered and given to a Customer. Make sure that you do a check of the Online Dealer Warranty (ODW) database to make sure that all necessary work is done to every vehicle.

Reason for this Quarantine Notice

There can be a problem when DB11 V12 is parked in rain. Water can go into the bonnet vents and collect on the coil pack seal. The water can then go into the breather pipe for the spark plug cavity as the engine temperature decreases. When water touches the HT leads it can cause a misfire.

Water shields are now available that will keep water away from the ignition system.

Workshop Procedure

1. Open the bonnet.

2. Attach the left side water shield to the bonnet with three nuts (refer to Figure 1).



Figure 1

3. Repeat the procedure for the right side.

Part Data

Description	Part Number	Quantity
BONNET VENT WATER SHEDDER RH	HY53-02418-AA	1
BONNET VENT WATER SHEDDER LH	HY53-02419-AA	1

Warranty Data

Procedure and Labour Time

Description	Labour Time
Install 2 Bonnet-Vent Water Shields	0.1 hours

If you have any questions related to this Quarantine Notice, please contact: Aston Martin Technical Services on: +44 (0) 1926 644720, email: askamtech@astonmartin.com, Or contact your After Sales Manager.

The English version of this Quarantine Notice is written in Simplified Technical English to ASD-STE100™.