

SERVICE ACTION

Reference number:	SA-03-1159	Issued: 26 February, 2019
Subject:	Bonnet-Vent Water Shields	
Model(s):	DB11 V12	
VIN range:	Refer to the separately published list of Vehicle Identification Numbers (VINs)	
Applicable to:	All Dealers	
Distribute to:	After Sales Manager Executive Manager Service Manager Sales Manager	Warranty Staff Technician(s) Parts Staff

Reason for this Service Action

There can be a problem when DB11 V12 is parked in rain. Water can go into the bonnet vents and collect on the coil pack seal. The water can then go into the breather pipe for the spark plug cavity as the engine temperature decreases. When water touches the HT leads it can cause a misfire.

Water shields are now available that will keep water away from the ignition system.

Workshop Procedure

1. Open the bonnet.
2. Attach the left side water shield to the bonnet with three nuts (refer to Figure 1).



Figure 1

3. Repeat the procedure for the right side.

Part Data

Description	Part Number	Quantity
BONNET VENT WATER SHEDDER RH	HY53-02418-AA	1
BONNET VENT WATER SHEDDER LH	HY53-02419-AA	1

Warranty Data**Procedure and Labour Time**

Description	Labour Time
Install 2 Bonnet-Vent Water Shields	0.1 hours

Please Note:

When you have completed this Service Action, make sure that you make an entry in Section A of the Vehicle Owner's Guide to show that the procedure is completed.

If you have any questions related to this Service Action, please contact: Aston Martin Technical Services
on: +44 (0) 1926 644720, email: askamtech@astonmartin.com,
or contact your After Sales Manager.

The English version of this Service Action is written in
Simplified Technical English to ASD-STE100™.