



Service Bulletin

Bulletin No.: 18-NA-301

Date: January, 2019

TECHNICAL

Subject: Service 4WD Lamp Message Displayed - DTC C119B 04, P0700, and/or P2534 Set

| Brand: | Model: | Model Year: | | VIN: | | Engine: | Transmission: |
|-----------|----------------------------|-------------|------|------|----|----------|---------------|
| | | from | to | from | to | | |
| Chevrolet | Silverado 1500 (New Model) | 2019 | 2019 | | | L84, L87 | |
| GMC | Sierra 1500 (New Model) | | | | | | |

| | |
|-----------------------------------|--|
| Involved Region or Country | North America, Middle East, South America, North Africa and Thailand (ASEAN). |
| Additional Options (RPOs) | F48 , NPO and NQH. |
| Condition | <p>Some customers may comment that the Service 4WD light is on. Some technicians may find one or more of the following DTC's set:</p> <ul style="list-style-type: none"> • C119B 04: Front Axle Engagement Feedback Switch Circuit set in the TCM • P0700: Transmission Control Module Requested MIL Illumination • P2534: Ignition On/Start Switch Circuit Low Voltage set in the ECM |
| Cause | This condition may be caused by the front axle actuator pulling over 5 amps, blowing the fuse. |
| Correction | <div data-bbox="683 1173 1317 1671" data-label="Image"> </div> <p>4698775</p> <p>Locate fuse #47 and/or #83 in the Front Compartment Fuse Block. Refer to Document ID: 4694932 in SI.</p> <ul style="list-style-type: none"> • Replace fuse #47: Transmission control module ignition with a 10A fuse. • Replace fuse #83: FTZM with 30A fuse. • Install new fuse block cover. <p>⇒ New cover reflects the changes to the fuses for two circuits.</p> |

Parts Information

No parts are required for this repair.

| Causal Part | Description | Part Number | Qty |
|-------------|---------------------------|-------------|-----|
| X | FUSE, 10 A | 19209792 | 1 |
| X | FUSE, 30 A | 19209796 | 1 |
| N/A | COVER, ENG WRG HARN J/BLK | 84594612 | 1 |

Warranty Information

For vehicles repaired under warranty, use:

| Labor Operation | Description | Labor Time |
|-----------------|------------------|---|
| 5430130 | Fuse Replacement | Use the Published Labor Operations Time |

| | |
|----------|---------------------------|
| Version | 1 |
| Modified | Released January 17, 2019 |

