

## **Service Bulletin**

Bulletin No.: 19-NA-003

Date: January, 2019

## **INFORMATION**

Subject: Automatic Park Brake Feature in Trailer Hitch View Not Functioning

Brand:	Model:	Model Year:		Breakpoint:		Engino	Transmission:
		from	to	from	to	Engine:	
Chevrolet	Silverado 1500 (New Model)	2019	2019	SOP	November 15, 2018	All	All
GMC	Sierra 1500 (New Model)						

Involved Region or Country	North America and NA Export vehicles		
Additional Options (RPOs)	Equipped with VISION-270 & REAR TRAILER VIEW, MONO, HD DIGITAL or VISION-REAR VIEW, MONO, ANALOG (RPO UVI, UVC)		
Condition	Some customers may comment on the automatic park brake not functioning when using trailer hitch view mode.		
Cause	This condition may be caused by a software anomaly.		
Correction	An updated software calibration has been released to address this condition.		

## **Service Procedure**

Reprogram the Video Processing Module (VPM) with the latest calibrations available on TIS2WEB. Refer to Refer to Video Processing Module (VPM): Programming and Setup in SI.

**Important:** Stable battery voltage is critical during programming. Any fluctuation, spiking, over voltage or loss of voltage will interrupt programming. Install the *EL-49642* SPS Programming Support Tool to maintain system voltage. If not available, connect a fully charged 12 V jumper or booster pack disconnected from the AC voltage supply. **DO NOT** connect a battery charger.

## **Warranty Information**

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information:

Labor Operation	Description	Labor Time		
2886088*	Video Processing Module Reprogramming	1.0 hrs.		
*This is a unique Labor Operation for Bulletin use only.				

Version	1
Modified	Released January 15, 2019

