

ServiceNews Article

March 2019 11536 Version 1

Popping or Crackling from the Speakers? Check the MOST Bus Network

AFFECTED VEHICLES

Year	Model	Trim
2018-19	Odyssey	ALL except LX
2019	Pilot	ALL except LX
2019	Passport	ALL except Sport

Are you hearing a popping or crackling from the speakers? This may be due to a connection issue in the MOST bus network, which can be identified by the unique red and green connectors at each component of the infotainment system.

During component inspection or replacement, you can easily damage these connectors if the cable is used for leverage when unplugging them.

To save you time during troubleshooting, check the repair history on the vehicle. Most reported cases happened after a separate previous repair was made to the system. Be sure to inspect the MOST connectors at all components and any connections between the harnesses. If a connector is found to be damaged, like you see here, the entire harness must be replaced. These connectors **are not** repairable.



If you want more info on what the MOST bus network does, look up the *Tech2Tech*® video, "Lets Talk MOST Bus Network and ECL Diagnostics".