



Technical Service Bulletin

60 Panoramic sunroof noises

60 19 24 2054203/1 March 7, 2019.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q7	2017	All	Not Applicable
Q7	2018	000001 - 044739	Not Applicable

Condition

Customer states:

- Noises are heard in the panoramic sunroof particularly while driving over rough roads. These noises occur mainly when the sunroof glass panel is closed.

Technical Background

The panoramic sunroof drive mechanism may be inadequately lubricated or not lubricated at all.

Production Solution

The lubrication strategy and amount corrected in production.

Service

The sunroof mechanism on the Q7 (model 4MB) is maintained using a cleaner and lifetime lubricant unique to the sunroof frame on this Q7 model compared to the previous Q7 model.



Technical Service Bulletin



Figure 1. All purpose cleaner: **G 065 567 A2.**



Figure 2. Special lubricant: **G 060 567 A2.**



Note:

The only maintenance materials approved for use on the sunroof frame are the cleaner and lubricant specified above. Alternative cleaners and lubricants used on this sunroof mechanism may cause permanent mechanical damage and worsen the level of noise from the sunroof mechanism.

If the sunroof mechanism has been lubricated with an unapproved lubricant it must be thoroughly cleaned off of the mechanism components using the cleaner G 065 567 A2 and lubricated with the approved lubricant G 060 567 A2.

1. Remove the front glass panel using the procedure specified in the repair manual. The mechanism can be moved slightly towards the rear for better access to the areas that require lubrication.



Technical Service Bulletin

2. Figure 3 shows the left slide and tilt mechanism. The upper left arrow points to front of the vehicle. The lower arrow points to the first mounting point of the glass panel.



Figure 3. Left side of slide and tilt mechanism.

3. There is a lug under the first mounting point (Figure 4, red arrow). This point has to be lubricated with G 060 567 A2 lubricant.



Figure 4. Lug to be lubricated on slide and tilt mechanism.



Technical Service Bulletin

4. Figure 5 and 6 shows the right slide and tilt mechanism from the inside. The groove indicated by the red arrow should be lubricated with G 060 567 A2 lubricant.



Figure 5. Groove in the slide and tilt mechanism.



6. Lubricating the groove in the slide and tilt mechanism.

Figure



Technical Service Bulletin

5. Figure 7 and 8 shows the rear section of the left side and tilt mechanism that must be lubricated with G 060 567 A2 lubricant. The outer area of this bracket will be lubricated (see red arrow).



Figure 7. Section of slide and tilt mechanism to be lubricated.



Figure 8. Bracket after lubrication.



Technical Service Bulletin

6. Figure 9 and 10 shows the left front slide and tilt mechanism. The channel that must be lubricated can be accessed with the spray tube through the first hole in the arm as shown.



Figure 9. Accessing the channel through the arm of the slide and tilt mechanism.



Figure 10. Close up view of the lubrication of the channel under the arm of the slide and tilt mechanism.



Note:

Perform this procedure to both sides of the sunroof slide and tilt mechanism.



Technical Service Bulletin

7. Reinstall and adjust the front glass panel using the procedure specified in the repair manual. Fully open and close the glass panel at least twice. Finally, perform a basic setting adaptation on the sunroof drive system.

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 6 Months/6,000 Miles.• 1EB over 6 Months/6,000 Miles up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	6035		
Damage Code:	0020		
Labor Operations:	Glass tilting roof panel remove and reinstall	60 39 19 00	See SRT
	Perform lubrication of slide and tilt mechanism – right and left sides	60 29 99 99	10 TU
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to service procedure	0121 0002	10 TU
	Road test after service procedure	0121 0004	10 TU
Claim Comment:	As per TSB #2054203/1		



All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



Technical Service Bulletin

Required Parts and Tools

The part numbers mentioned in this TSB are different than the ones listed in ETKA. Only use parts listed in this TSB, this includes superseding part numbers!

Part Number	Part Description	Quantity
G 065567A2	 All purpose cleaner	0.3
G 060567A2	 Special lubricant	0.3



Technical Service Bulletin

Additional Information

All parts and service references provided in this TSB (2054203) are subject to change and/or removal. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2019 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.