



Technical Service Bulletin

91 MIB2 High Scale: rearview camera/overhead view camera does not turn on

91 19 42 2053532/1 March 4, 2019.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3, A4,	2017 - 2018	All	MIB2 High Scale
A5, Q5	2018	All	MIB2 High Scale

Condition

Customer states:

- The rearview/overhead view camera and the optical parking aid are sporadically not switched on when moving into reverse. The previously adjusted menu (radio, navigation etc.) stays the same (Figure 1).
- The parking aid button in the center console lights up and an acoustic obstacle warning is given.



Figure 1. Previously adjusted menu stays the same.



Technical Service Bulletin

Technical Background

The MIB2 High Scale software needs to be updated.

Production Solution

New infotainment software introduced into MY19.

Service

Required equipment:

- ODIS Tester
- SVM code
- MIB2 High Software update on SD Card (See *Required Parts and Tools* or Download the software from MirrorServer using the SD Creator Program)

Time to complete update:

- Approximately 30-60 minutes (includes 20-50 minutes for the software update and 10 minutes for the SVM work)

Service work:

Update the MIB2 Scale infotainment system using either Method 1 or Method 2 according to TSB 2050565: *91 MIB2 High Scale Software Update Instructions (PR Code 7UH)* and use SVM code indicated below:

Vehicle	SD Creator Part Number	SVM Code
A3, A4, A5, and Q5	4M0906961CD	MHS2US2037

Method 1: Automated update using ODIS

Method 2: Manual update due to SVM code or Server issues



Technical Service Bulletin

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9196		
Damage Code:	0039		
Labor Operations:	Software Update	0151 0000	According to TSB #2047576
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2053532/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Part Number	Part Description	Quantity
4M0906961CD	MMI software update (SD Card) – Or download via SD creator Software	01 (Shop tool)

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2047812, *00 SD Creator: how to setup and use the SD Creator for obtaining vehicle software updates via the MirrorServer*.
- TSB 2050565: *91 MIB2 High Scale Software Update Instructions (PR Code 7UH)*.

All part and service references provided in this TSB (2053530) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.



Technical Service Bulletin

©2019 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.