



Technical Service Bulletin

91 Front parking aid provides false warnings

91 19 45 2053801/2 March 8, 2019. Supersedes Technical Service Bulletin Group 91 number 19-31 dated February 1, 2019 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q8	2019	000001 - 020744	With zFAS Level A

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised <i>Warranty</i> (Updated Damage Code)
1	02/01/2019	Initial publication

Customer states:

- The parking aid system gives false warnings from the front sensors without any object in the vicinity.
- The vehicle is equipped with zFAS Level A.

Technical Background

A software issue is present in the sensor adaptation that causes a false warning.

Production Solution

An improved dataset for the vehicle electrical system control module, J519 (address word 0009) has been introduced in production.

Service

For all Q8 with Front Sensors Driver Assistance System (00A5) and Part Number 4KE907107AA:

1. Inspect the front parking aid sensors for damage or incorrect mounting.
2. If the parking aid sensors are okay, update the vehicle electrical system control module, J519 (address word 0009) dataset using the SVM Update Instructions below.



Technical Service Bulletin

SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the vehicle electrical system control module, J519 (address word 0009) using the SVM action code as listed in the table below, if necessary:

Model	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Code Input
Q8	4M8909514B 4M8909514E 4M8909514D	*	4M8909514VE	0001	09A042

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9175		
Damage Code:	0040		
Labor Operations:	Software Update	0151 0000	Time stated on diagnostic protocol (Max 75 TU)
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2053801/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



Technical Service Bulletin

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions*.

All part and service references provided in this TSB (2053801) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2019 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.