

SSM 47797	<p>Some 2009-2017 Expedition/Navigator, 2009-2014 F-150/Mustang, 2008-2009 Sable, 2008-2019 Taurus/Flex/MKT, 2013-2019 Police Interceptor Sedan/Utility, and 2011-2019 Explorer vehicles may exhibit inoperative or intermittent HVAC blower motor function at various fan speed settings. This may be due to a poor electrical connection at the blower motor speed control. If the blower motor speed control is determined to be the causal part, replacement of the electrical connector pigtail harness (14S411) to the blower motor speed control is also recommended to avoid repeat repairs. Refer to Wiring Diagram, Cell 5 for recommended splicing procedures. Refer to Wiring Diagram, Cells 54/55 to obtain the service pigtail connector part number.</p>
-----------	---