

SSM 47803	<p>Some 2018 EcoSport vehicles equipped with a dealer installed remote start feature and built on or before 20-Mar-2018 may exhibit an intermittent illuminated wrench indicator lamp along with DTC P166A and a See Manual message on the information display in the instrument panel cluster (IPC). This may be due to the key takeover process being initiated during the remote start session. Reprogram the body control module (BCM) using the latest software version of the appropriate Ford diagnostic scan tool. This message does not include vehicles in FSA 18B07 equipped with SYNC connect or factory invoiced accessories (FIA) remote start. For claiming, use causal part 14G490 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.</p>
-----------	---