

MFR Communication ID	MFR Communication Date	Make (Brand)	Model	Model Year	Text
SSM 47846	3/5/2019	Ford	Edge	2019	Some 2019 Mustang, Continental, Fusion, MKZ, F150, Transit Connect, Ranger, Edge or Nautilus with SYNC 3 may have the following intermittent symptoms: a solid blue screen when moving forward at speeds above 10 mph, the rear view camera remains on the screen at speeds below 10 mph, or inoperative infotainment applications. To resolve this concern, check for a SYNC software update under the OASIS Tab SYNC selection. If an update is available, update the APIM software per WSM section 415-00. After the complete pop-up appears, remove the USB flash drive and install it into the IDS tool to update the Ford database. Perform a complete ignition cycle by turning the key off for 5 minutes, which is critical for a successful
			F-150	2019	
			Fusion	2019	
			Mustang	2019	
			Transit Connect	2019	
		Lincoln	Continental	2019	
			MKX	2019	
			MKZ	2019	