

MFR Communication ID	MFR Communication Date	Make (Brand)	Model	Model Year	Text
SSM 47875	3/18/2019	Ford	C-MAX	2014	Some 2014-2019 Escape, 2014-2018 C-MAX, Focus, and Transit Connect vehicles not equipped with an auto start/stop system may exhibit an inability to program and/or no electrical power after installation of a service part body control module (BCM). Inspect the BCM for the presence of fuse F88. If fuse 88 is missing, install a 25 amp fuse and then re-evaluate the concern. If fuse 88 is installed in a vehicle with an auto start/stop system, the vehicle may exhibit concerns where the radio is turning off during an auto start/stop event and the instrument panel cluster (IPC) back lighting slowly goes dim during auto start/stop events.
				2015	
				2016	
				2017	
				2018	
			Escape	2014	
				2015	
				2016	
				2017	
				2018	
			Focus	2014	
				2015	
				2016	
				2017	
				2018	
			Transit Connect	2014	
				2015	
				2016	
				2017	
				2018	