



Bulletin No.: PIT5659

Published date: N/A

Preliminary Information

PIT5659 Driver Side Power Seat Inoperative


Models


Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Blazer	2019	All	All	All	All

Involved Region or Country	North America
Additional Options (RPO)	AAB
Condition	A vehicle may arrive at the dealer with a complaint that the driver's side power seat will not move at times. Upon checking for codes a B3920 may be found.
Cause	The wire harness may be pinched between the memory seat module bracket and the seat cushion frame tube.

Correction:

Inspect the seat harness for being improperly routed and pinched between the memory seat module bracket and the seat frame tube.

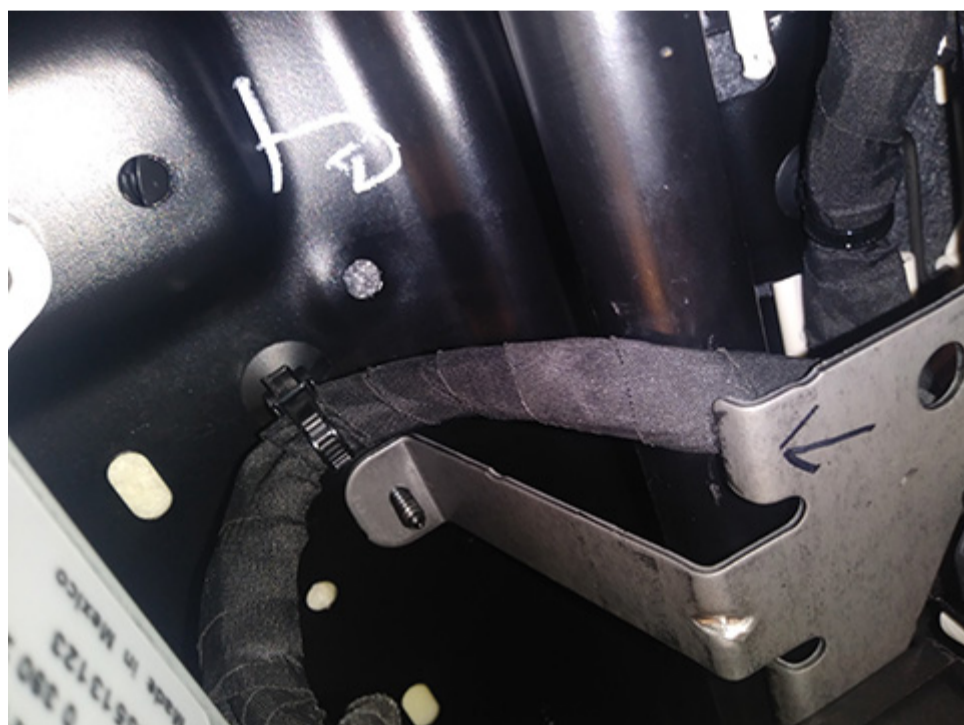

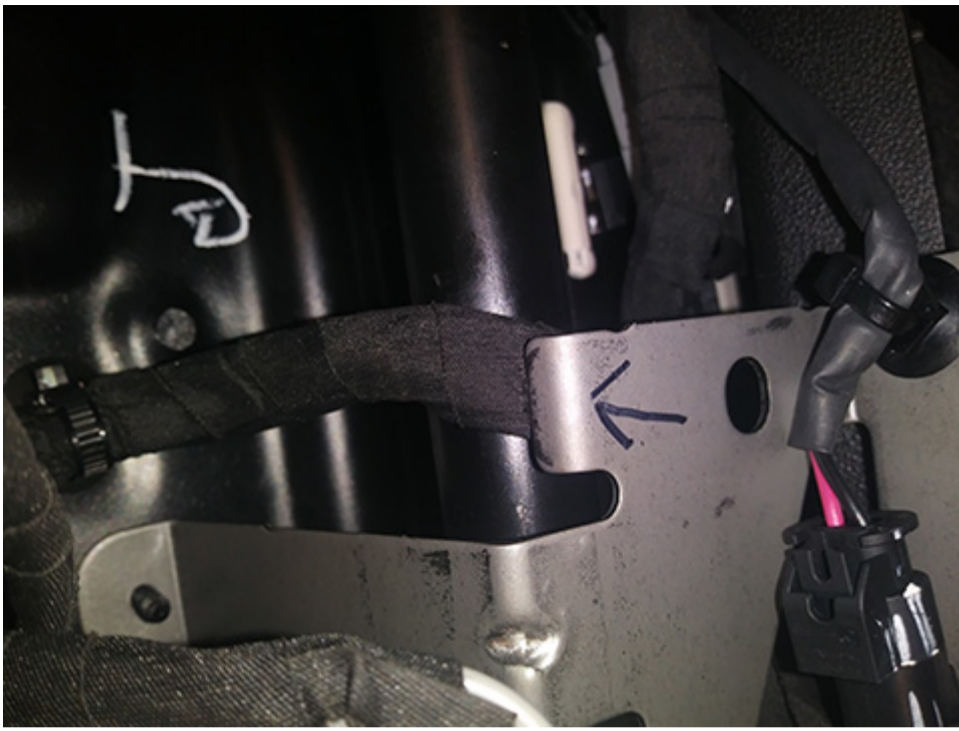

Repair or replace the seat harness as needed and re-route it so that it will not become pinched or damaged.

Note: This PI may be converted to a Bulletin in the future if new information becomes available.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
7013300	Front Seat Wiring Harness Inspection and repair or replace	ST

Version History

Version	1
Modified	03/05/2019 - Created on



GENERAL MOTORS

© 2019 General Motors. All Rights Reserved.