



Preliminary Information

PIC5894A Multiple IPC Warning Indicators DIC Messages Displayed and or Loss of Communication DTCs in Various Modules

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Impala	2014	ALL	ALL	ALL	ALL


The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition / Concern

A Customer may comment that there are multiple IPC warning indicators on and/or warning messages being displayed on the DIC.

During initial scan for diagnostic codes you may find one or more of the following DTCs stored in various Modules: U0073, U0077, U0078, U0121, U0126, U0151, U0155, U0164, U0186, U0415, U0422, U0428.

These conditions can be caused by a pinched DLC branch in the IP Harness behind the IP Carrier.

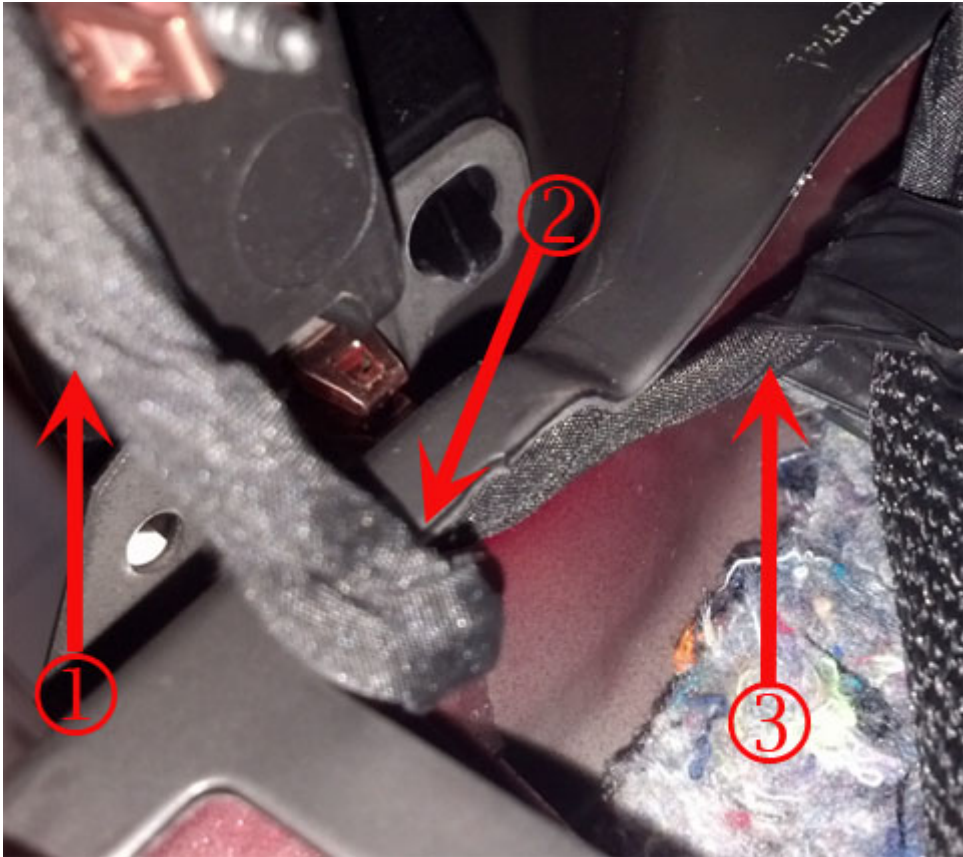

- 1) To DLC
- 2) Location of Pinch
- 3) To BCM



1) Location of Pinched DLC branch directly behind IP Carrier

Note: This PI may be converted to a Bulletin in the future if new information becomes available.

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin **10-00-89-005** for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.



GENERAL MOTORS