

**Published date:** 03/15/2019

# **Preliminary Information**

## PIP5633 P015B Setting L84 L87

#### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to	Engine.	Transmissions.
Chevrolet	Silverado 1500 (New Model)	2019	All	All	5.3 6.2 L82 L84 L87	All
GMC	Sierra 1500 (New Model)	2019	All	All	5.3 6.2 L82 L84 L87	All

Involved Region or Country	North America
Condition	A vehicle may have a check engine lamp on with a P015B stored.
Cause	Possible intake manifold or exhaust system leak

#### Correction:

Before replacing any parts be sure to follow SI Document 4915712 and check for the following.

B52 Heated Oxygen Sensor — Water intrusion at Harness Connector

- ° Coolant consumption » Refer to: Loss of Coolant
- Vacuum leak at Engine / Hoses / Lines
- Oil consumption » Refer to: Oil Consumption Diagnosis
- Evaporative Emission Canister Saturated with fuel
- Fuel Contaminated / Poor Quality » Refer to: Alcohol/Contaminants-in-Fuel Diagnosis
- Fuel injectors which do not close completely. » Refer to: Fuel Injector Diagnosis
- Fuel pressure that is too low or too high. » Refer to: Fuel System Diagnosis
- Exhaust System Leaking / Loose Clamps / Visible Damage » Refer to: Symptoms Engine Exhaust
- Fuel Injectors Restricted » Refer to: Fuel Injector Diagnosis

NOTE: As further information becomes available this PI will be updated or replaced with a bulletin as needed.

### <u>Version History</u>

Version	1
Modified	03/15/2019 -Created on.















