

Bulletin No.: PIT5633B Published date: 03/22/2019

Preliminary Information

PIT5633B Power Folding Mirror(s) Does Not Stop at the Correct Location / Do Not Move / Make Grinding Noise / or Will Fold Completely Forward

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to	Engine.	Transmissions.
Chevrolet	Silverado 1500 (New Model)	2019	All	All	All	All
GMC	Sierra 1500 (New Model)	2019	All	All	All	All

Involved Region or Country	North America
Additional Options (RPO)	DEZ- Power Folding Mirrors
	Some customers may comment that the power folding mirror(s):
	- Do not stop at the correct location
Condition	- Do not move and make a grinding noise
	- Fold completely forward.
	This concern could be caused by an issue with the mirror head pivot stop/detent. This
Cause	concern is more likely to occur if the mirrors are power folded in while going through a
	car wash.

Correction:

Engineering has released an updated mirror assembly with improvements to the mirror head pivot stop/detent. To correct this concern, replace the affected mirror assembly using current CCA stock.

This PI may be converted to a bulletin shortly.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
2050220	Outside Rearview Mirror Replacement	Use Published Time

Version History

Version	3	
	09/28/2018 - Created on	
Modified	10/23/2018- Superseded to update the title, condition, correction, and	
Wiodiffed	warranty sections.	
	03/22/2019 - Superseded update the correction	

















GENERAL MOTORS

© 2019 General Motors. All Rights Reserved.