



LTB01270NAS1

TECHNICAL BULLETIN

11 FEB 2019

© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

SECTION:

413-00

SUBJECT/CONCERN:

'Driver Intervene' Message Intermittently Displayed On Instrument Cluster

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
Range Rover (LG)	2018	377528-526405	Solihull

MARKETS:

NORTH AMERICA

CONDITION SUMMARY:**SITUATION:**

A 'Driver Intervene' message may be intermittently displayed on the Instrument Cluster and the adaptive cruise control driver intervention system operates when not required, with unexpected braking at low speed. Upon further investigation, no related DTC (Diagnostic Trouble Code) will be stored.

CAUSE:

This may be caused by false operation of the adaptive cruise control driver intervention system due to radar wave reflection within the front bumper cover.

ACTION:

Should a customer express this concern, follow the Workshop Procedure(s) below.

PARTS:

PART NUMBER	DESCRIPTION	QUANTITY
LR101708	Foam block with adhesive pad	2

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:**NOTES:**

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Use TOPIx to obtain the latest repair time.
- The JLR claims submission system requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Front armature - Install foam pads	76.22.89.41	0.8	42	LR099110


 **NOTE:**

Normal Warranty procedures apply.

SERVICE INSTRUCTION:


- 1 Remove the front bumper (see TOPIx Workshop Manual section 501-19: Bumpers - Front bumper).

2

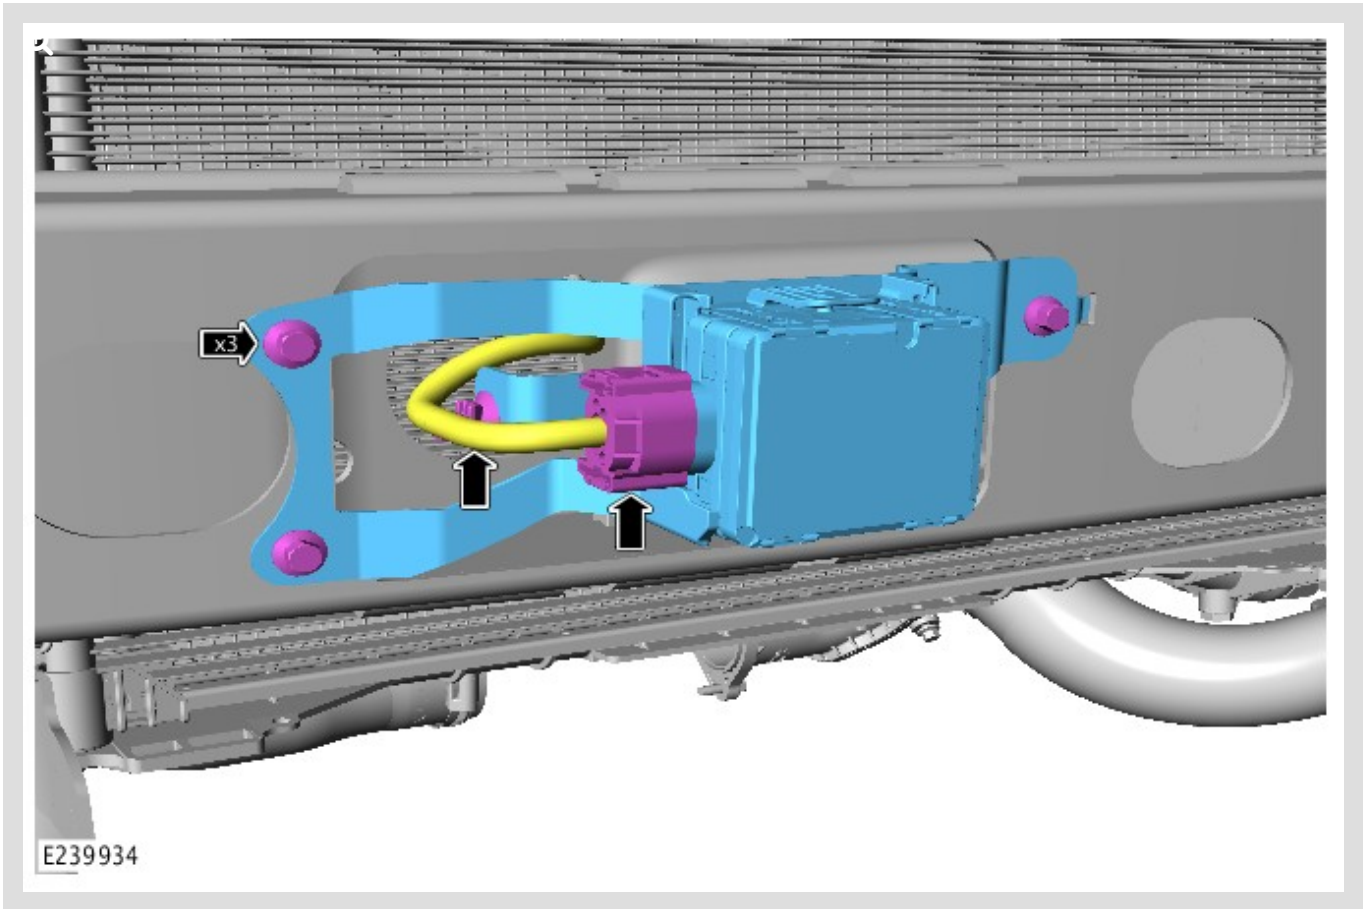


Remove the radar bracket.

3

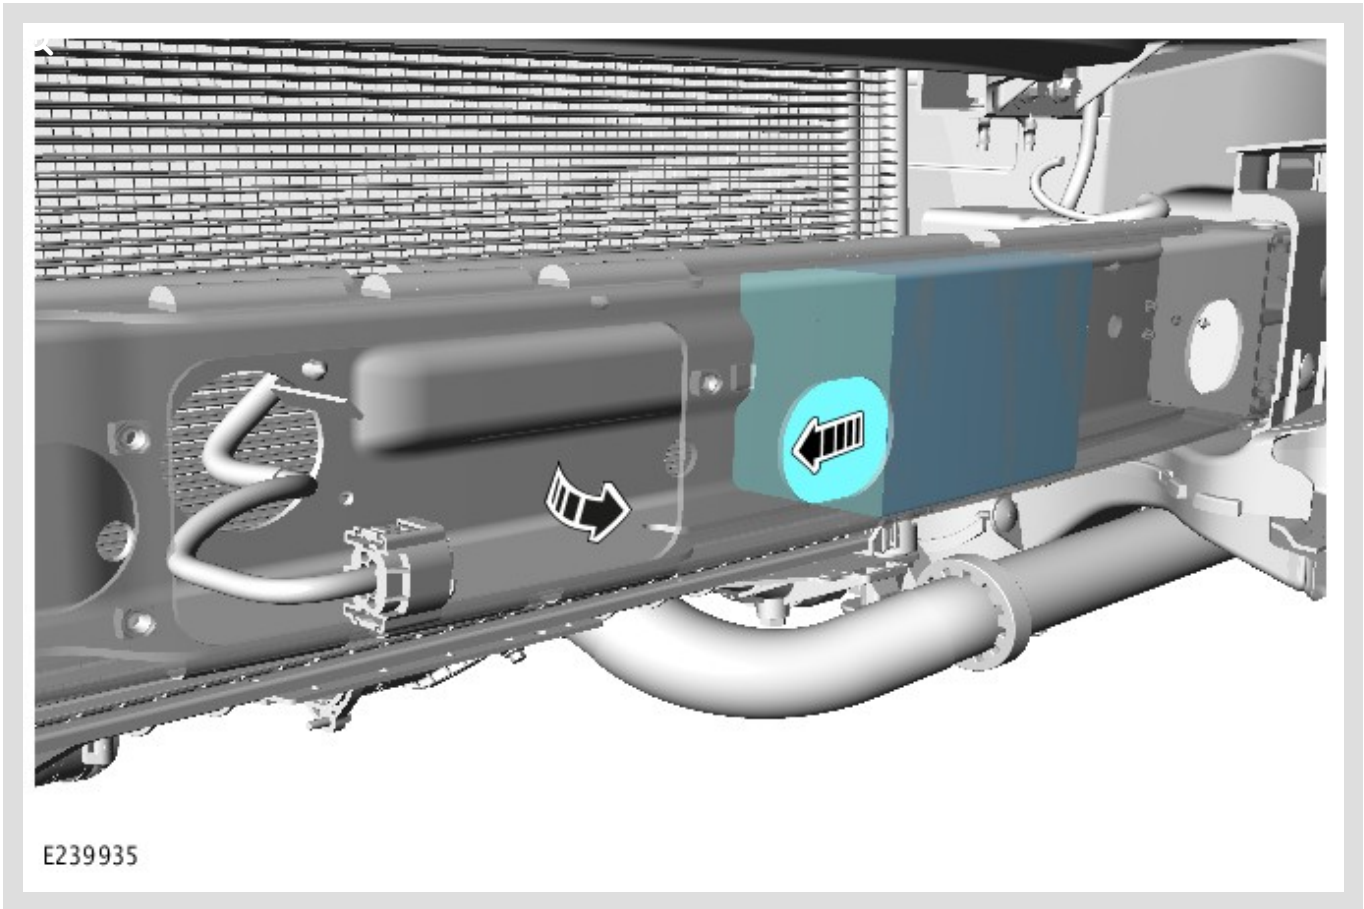


Only if necessary: remove and discard the existing foam block(s).

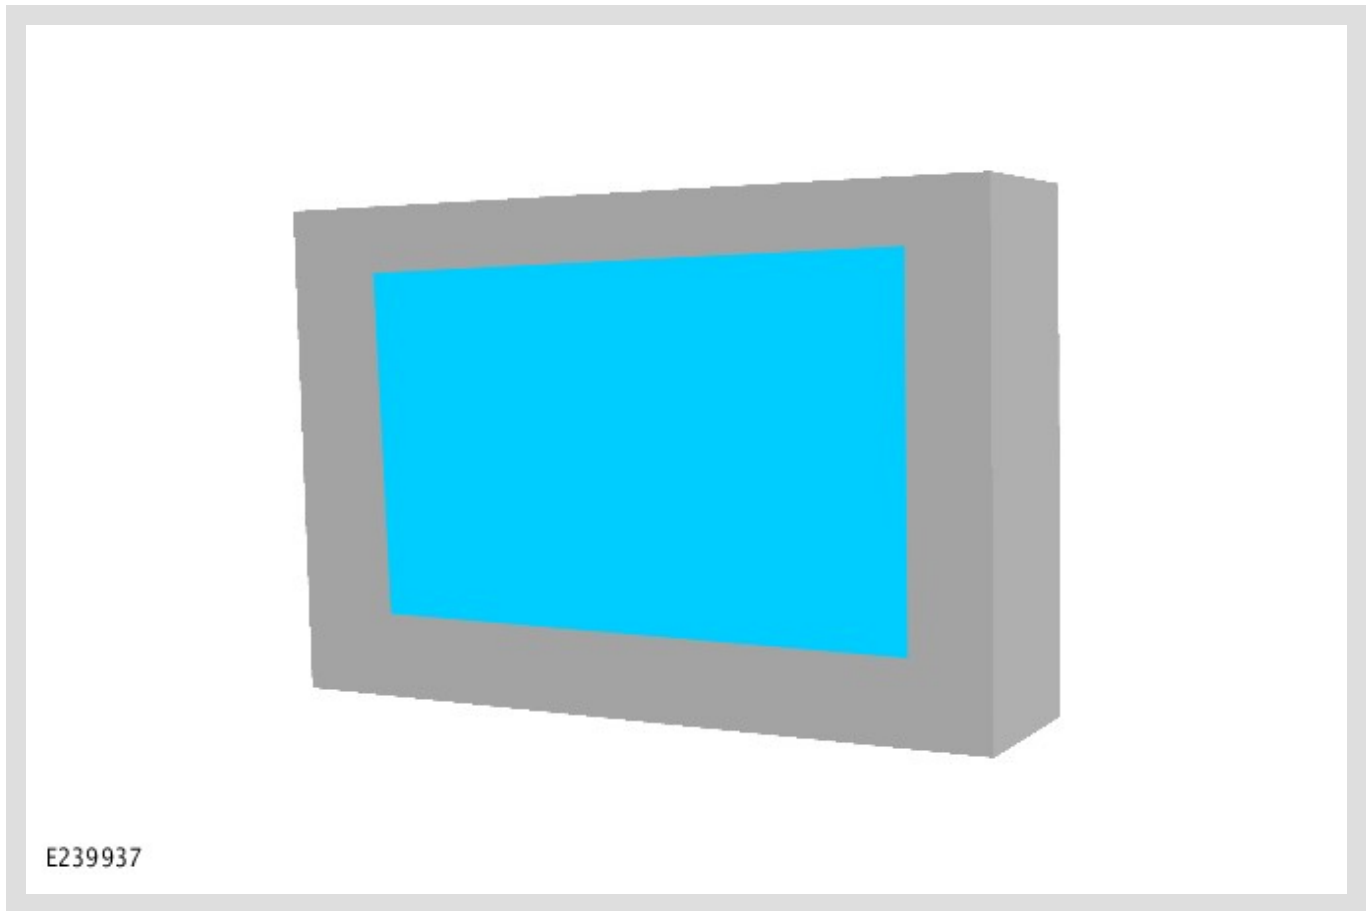

Remove the adhesive pads from each new foam block.

- Join the new foam blocks together.

5

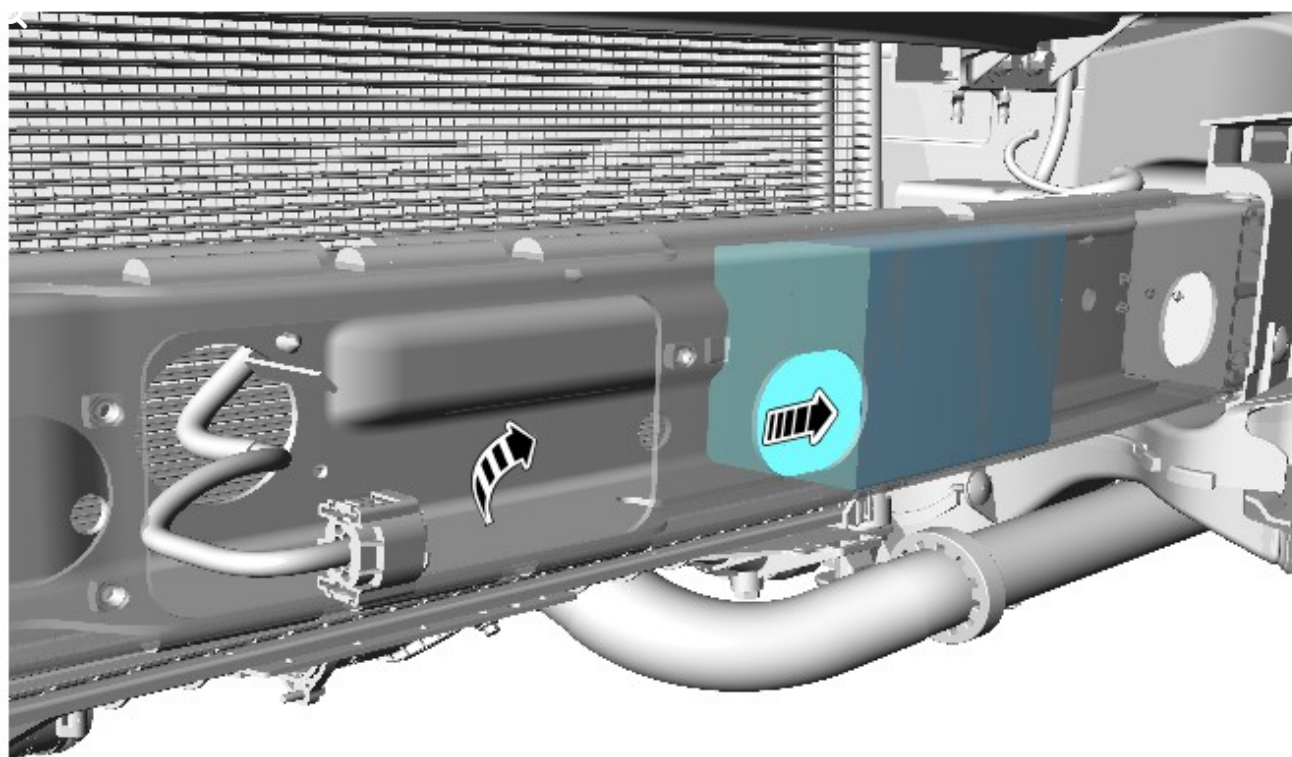

E239938

Install the new foam blocks.

6

 **NOTE:**


The foam blocks will expand for 5 minutes when the bag is pierced.

Pierce the foam block bags.

7


 **NOTE:**

Make sure the foam blocks are installed level with the highlighted hole.

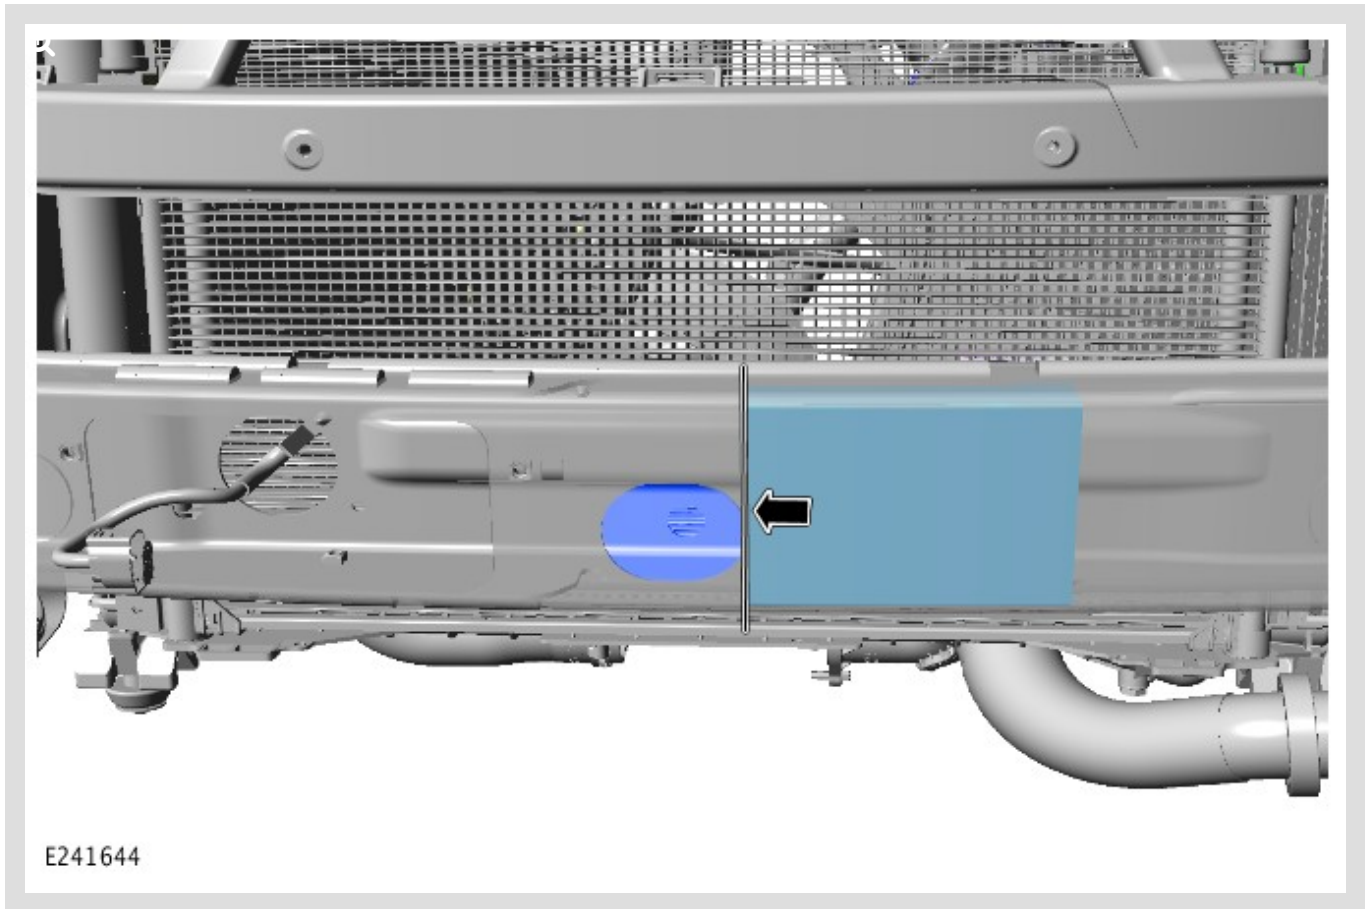

Install the new foam blocks as shown.

8

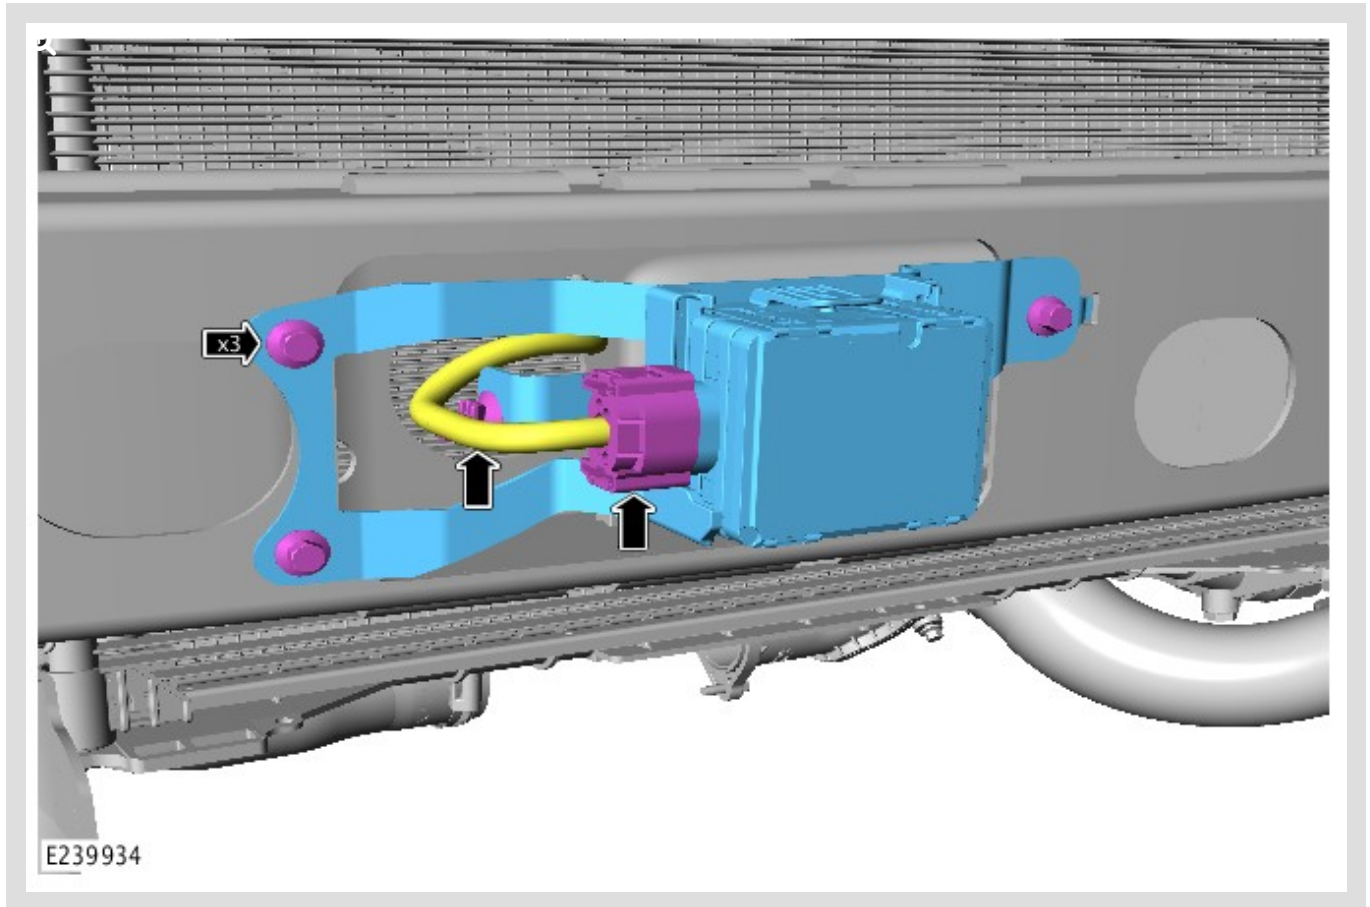

Install the radar bracket.

- Torque: **10 Nm**

9 Install the front bumper (see TOPIx Workshop Manual section 501-19: Bumpers - Front bumper).