



# Technical Service Bulletin

## 91 Reading light turns on without input from the customer

91 19 40 2053866/1 February 22, 2019.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A8	2019 - 2020	All	Not Applicable.

## Condition

### Customer states:

- The rear reading light turns on without input from the customer.

### Workshop findings:

- No DTCs are stored.

## Technical Background

The software needs to be updated. The optimized software will optimize the touch detection sensitivity.

## Production Solution

New software in the interior light control module 2 (address word 0WX2) addressed the condition.

## Service

### SVM Update Instructions

- Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
- Update the interior light control module 2 (address word 0WX2) using the SVM action code as listed in the table below, if necessary:

Model	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Code Input
A8	4N0947111D 4N0947111E 4N0947111F	*	4N0947111D 4N0947111E 4N0947111F	0060	61ES001



# Technical Service Bulletin

	4N0947111G		4N0947111G		
A8	Other	*	*	0063	61ES001

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"><li>• 110 up to 48 Months/50,000 Miles.</li><li>• G10 for CPO Covered Vehicles – Verify Owner.</li><li>• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li></ul>		
<b>Service Number:</b>	9646		
<b>Damage Code:</b>	0040		
<b>Labor Operations:</b>	Software Update	0151 0000	Time stated on diagnostic protocol (Max 75 TU)
<b>Diagnostic Time:</b>	GFF	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
<b>Claim Comment:</b>	As per TSB #2053866/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions*.

All part and service references provided in this TSB (2053866) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2019 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in



# Technical Service Bulletin

---

any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.