



Technical Service Bulletin

64 Rear quarter glass intermittently retracts after closing convertible top

64 19 63 2048934/4 February 7, 2019. Supersedes Technical Service Bulletin Group 64 number 18-61 dated October 19, 2018 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A5 Cabriolet, S5 Cabriolet	2018	000001 - 012661	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
4	-	Revised <i>Service</i> (Added Tip)
3	10/19/2018	Revised header data (Added filters and updated VIN break) Revised <i>Service</i> (Updated SVM table versions) Revised <i>Warranty</i> (Added Labor Operation)
2	03/02/2018	Revised header data (Added filters) Revised <i>Service</i> (Updated SVM table versions)

Customer states:

- After operating the convertible top, the rear quarter glass rolls down automatically. Condition occurs intermittently, and can occur on one, or both rear quarter glass.

Technical Background

Not applicable.

Production Solution

New software in the front passenger door control module, J387 (address word 0052) and driver door control module, J386 (address word 0042) addressed the condition.



Technical Service Bulletin

Service

SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the driver door control module, J386 (address word 0042) or the front passenger door control module, J387 (address word 0052) using the SVM action code as listed in the table below, if necessary:



Tip: Prior to starting the SVM update, open all windows completely, then fully close all windows via the driver's door window switches. This will help to ensure that the door control modules are properly read into ODIS.

Model	Control Module Diagnostic Address	Old Software Part Number	New Software Part Number	New Software Version (or higher)	SVM Code Input
A5 Cab 2018 S5 Cab 2018	0042	4M0959793F 4M0959793H	4M0959793H	0130	42A014
A5 Cab 2018 S5 Cab 2018	0052	4M0959792F 4M0959792H	4M0959792H	0130	42A014

3. Perform basic settings of all four windows.



Technical Service Bulletin

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles• G10 for CPO Covered Vehicles – Verify Owner• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	6438		
Damage Code:	0039		
Labor Operations:	Software Update	0151 0000	Time stated on diagnostic protocol (Max 100 TU)
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2048934/4		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions*.

All parts and service references provided in this TSB (2048934) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2019 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.