

# LATEST VEHICLE CONCERN FIXES



## Check Engine Lamp illuminated and engine runs rough

14MY onwards Range Rover, Range Rover Sport, LR4, Discovery, RR Velar, XE, XF, XJ, F-TYPE, F-PACE equipped with AJ126

### Customer Voice:

- The Check Engine Lamp is on and the vehicle is running rough.

### Technical Description:

- DTCs vary, may include P2187-00, P2189-00, P013E-00, P014E-00. Fuel trims near limit when engine is at idle speed.

### Status:

- Isolate the part load PCV system from the engine air intake system. If fuel trims return to specification, the diaphragm in the PCV part load breather may be leaking.
- A lower level repair solution has been developed for the PCV diaphragm. We have a small number of parts and would like to gather feedback on the repair solution.
- If you encounter this condition, raise a TA so we can ship the repair kit and you can provide feedback.

