

Service Bulletin

Bulletin No.: 18-NA-144

Date: April, 2019

TECHNICAL

Subject: Multiple Electrical Concerns, Intermittent Multiple Instrument Panel Cluster (IPC)

Warning Lamps Illuminated, Intermittent Multiple Message on Drivers Information Center (DIC), Malfunction Indicator Lamp (MIL) Illuminated

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Silverado	2017	2018				
	Silverado LD	2019	2019				
GMC	Sierra	2017	2018			All	All
	Sierra Limited	2019	2019				

Involved Region or Country	North America, Middle East, Israel, Chile and Thailand		
	Some customers may comment on, but not limited to, one or more of the following conditions:		
	Note: Not all the effects or driver notifications listed have been experienced. However, the different effects and driver notifications may be caused by the module and wiring harness at the module. Components on different lines in the list below are in different circuits. Due to the cause of the condition, and the positions of the wires in the harness, it is unlikely that more than one circuit will be affected by the condition.		
	 IPC Warning Lamps Illuminated: ABS, Stabilitrac, brake warning, traction control, rear bulb outage, turn signals flashing fast, Steering Assist is Reduced Drive with Care, service power steering, Malfunction Indicator Lamp (MIL) 		
	 Intermittent and/or Inoperative Multiple Electrical Concerns: Left and/or Right side tail and/or signal light inoperative, rear camera, high speed GMLAN communication, chassis bus communication 		
	Note: This is a multi-wire bundled harness and, depending on which wire is damaged, can set a variety of DTCs.		
	Some technicians may find one or more of the following DTC set:		
	• C0035		
Condition	• C0040		
Condition	• C0045		
	• C0050		
	• C0710		
	• C1115		
	• C1116		
	• C1117		
	• C1118		
	• P0449		
	• P0453		
	• P0499		
	• P129D		
	• P2537		
	• P2537		
	• U007D		
	• U0073 • U0074		
	• 00074		


rage Z	Aprii, 2019 Buileuri No.: 16-NA-144
	• U0077
	• U0100
	• U0101
	• U0121
	• U0126
	• U0137
	• U0140
	• U0151
	• U0415
	• U0428
	• U1556
	• U18A2
	This condition may be caused by high resistance, opens, shorts and/or damage circuits in the chassis and electronic brake controller wiring harness.
	⇒ Shown below are some areas to pay particular attention to:
Cause	2
	5049626

- Body (1)
- Rear Crossmember (2)



5049632

• Frame/Leaf Spring Support Bracket

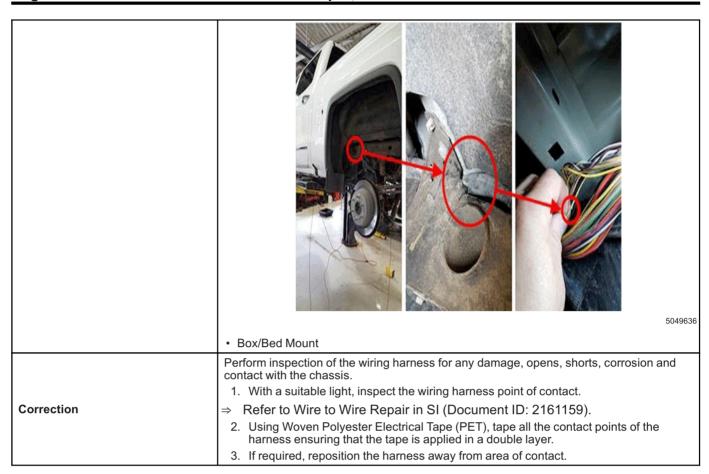

Parts Information

No parts are required for this repair.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time	
5430902	Wire to Wire Repair	Use the Published Labor Operations Time	

Version	2	
Modified	Released May 01, 2018	
	Revised March 28, 2019 – Added 2019 Model Year and DTC P0499 to Condition.	