



Service Bulletin

Bulletin No.: 19-NA-052

Date: March, 2019

TECHNICAL

Subject: Vehicle Lost Electrical Power and/or Vehicle Will Not Start

Brand:	Model:	Model Year:		Breakpoint:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Camaro	2016	2019			Equipped with 6.2L (LT1, LT4)	

Involved Region or Country	North America and N.A. Export Regions
Condition	Some customers may comment that the vehicle lost electrical power and/or will not start. A technician may find the F1RD - 350 amp mega fuse in the rear fuse block X50D has opened.
Cause	This condition may be caused by circuit 1 shorted to ground at the starter heat shield.
Correction	Replace the starter solenoid cable.

Service Procedure

Refer to *Starter Solenoid Cable Replacement (LT1, LT4)* in SI.

Parts Information

Causal Part	Description	Part Number	Qty
X	CABLE, STRTR SOL	84601785 (LT1)	1
		84601786 (LT4)	

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4041630	Starter Solenoid Cable Replacement	Use Published Labor Operation Time

Version	1
Modified	Released March 14, 2019

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION