

LATEST VEHICLE CONCERN FIXES



High Pressure Fuel Pump Failure P0087	17-19MY RR, RRS, Discovery 3.0L TDV6 17-19MY XE, XF, F-PACE, RR Velar AJ20D
<u>Customer Voice:</u> – Check Engine Light illuminated, Restricted Performance Message on IPC <u>Technical Description:</u> – P0087-22/21 setting for fuel rail pressure sensor <u>Status:</u> – Under Investigation – Ascertain the following information and include it in your TA submission: ✓ Follow all TOPIx procedures ✓ 1L fuel sample in a clean container, ✓ verify fuel quality ✓ picture of the filter (hold onto the part & inspect for debris), ✓ inspection of the pump (look for debris, signs rusting etc.), ✓ find out from the customer last fueling event (how much, location of fueling station, station company, approximate date) ✓ Diagnose any codes for injectors and hold onto those parts as well. ✓ Retain all parts replaced for these codes. They will be requested for return	

