

LATEST VEHICLE CONCERN FIXES



18MY-19MY – Discovery/Range Rover/ RR Sport

Customer Voice:

- Intermittently flat battery complaint
- All terrain response switchpack LEDs flashing

Technical Description:

- Cool box sending CAN signal that prevents the All Terrain Control Module from going into sleep mode.

Status:

- SSM 74232 – Published on 1/16/2019.
 - Replace the Floor Console Cool Box refer to TOPIx workshop manual section 501-12A
- Vehicle end VIN's
 - L405: SALGS2RE5JA380217
 - L462: SALRR2RV5KA096236
 - L494: SALWR2RE1JA181320
 - L494: SALWA2BK1JA695613

18MY-19MY – Discovery, Range Rover, RR Sport

