

LATEST VEHICLE CONCERN FIXES



Misdiagnosis of DTC B00C1 Stored In OCS Module	Range Rover, RR Sport 14 -19MY Discovery 17 – 19MY
<p>Customer Voice:</p> <ul style="list-style-type: none">- A customer may report that the SRS warning lamp is illuminated. <p>Technical Description:</p> <ul style="list-style-type: none">- A check of faults may find DTC B00C1-11, B00C1-12, B00C1-13 or B00C1-97 stored in the OCS module for the Passenger Seat Occupant Classification Sensor “ B “. <p>Status:</p> <ul style="list-style-type: none">- These DTCs are often misdiagnosed as a fault with the OCS module.- The Passenger Seat Occupant Classification Sensor “ B “ is the Belt Tension Sensor, which is part of the seatbelt reel assembly. It is mounted the side of the front passenger seat base frame.	 

